



aerospace
climate control
electromechanical
filtration
fluid & gas handling
hydraulics
pneumatics
process control
sealing & shielding



Pneumatic Air Motors

P1V-A large type: 1.6, 2.6 & 3.6 kW
P1V-B very large type: 5.1, 9 & 18 kW

Catalogue PDE2670TCUK April 2014



ENGINEERING YOUR SUCCESS.

Contents

General

Features 3 - 4
 Principles of air motors 5
 The steps to size 6 - 10
 Air quality 11

Large Air Motors P1V-A 13

Very Large Air Motors P1V-B 47



Important
 Before carrying out service activities, make sure the air motor is vented. Before disassembling the motor, disconnect the primary air hose to ensure that the air supply is interrupted.



Note
 All technical data in the catalogue are typical values.
 The air quality is a major factor in the service life of the motor, see ISO 8573-1.




WARNING
FAILURE OR IMPROPER SELECTION OR IMPROPER USE OF THE PRODUCTS AND/OR SYSTEMS DESCRIBED HEREIN OR RELATED ITEMS CAN CAUSE DEATH, PERSONAL INJURY AND PROPERTY DAMAGE.
 This document and other information from Parker Hannifin Corporation, its subsidiaries and authorized distributors provide product and/or system options for further investigation by users having technical expertise. It is important that you analyze all aspects of your application and review the information concerning the product or system in the current product catalog. Due to the variety of operating conditions and applications for these products or systems, the user, through its own analysis and testing, is solely responsible for making the final selection of the products and systems and assuring that all performance, safety and warning requirements of the application are met. The products described herein, including without limitation, product features, specifications, designs, availability and pricing, are subject to change by Parker Hannifin Corporation and its subsidiaries at any time without notice.

SALE CONDITIONS
 The items described in this document are available for sale by Parker Hannifin Corporation, its subsidiaries or its authorized distributors. Any sale contract entered into by Parker will be governed by the provisions stated in Parker's standard terms and conditions of sale (copy available upon request).


Features	Air motor	Hydraulic motor	Electric motor
Overload safe	***	***	*
Increased torque at higher loads	***	**	*
Easy to limit torque	***	***	*
Easy to vary speed	***	***	*
Easy to limit power	***	***	*
Reliability	***	***	***
Robustness	***	***	*
Installation cost	***	*	**
Ease of service	***	**	*
Safety in damp environments	***	***	*
Safety in explosive atmospheres	***	***	*
Safety risk with electrical installations	***	***	*
Risk of oil leak	***	*	***
Hydraulic system required	***	*	***
Weight	**	***	*
Power density	**	***	*
High torque for size	**	***	*
Noise level during operation	*	***	**
Total energy consumption	*	**	***
Service interval	*	**	***
Compressor capacity required	*	***	***
Purchase price	*	*	***

* = good, **=average, ***=excellent

P1V-A & B Air Motors

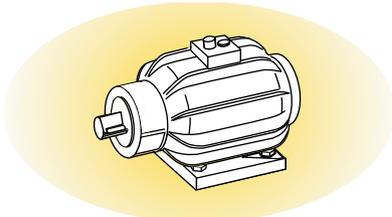

Air motors have much smaller installation dimensions than corresponding electric motors.

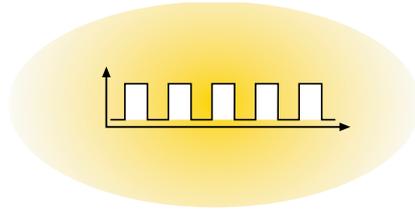


Air motors can be stopped and started continually without damage.




Air motors can be loaded until they stall, without damage. They are designed to be able to withstand the toughest heat, vibration, impact etc.




The simple design principle of air motors make them very easy to service.

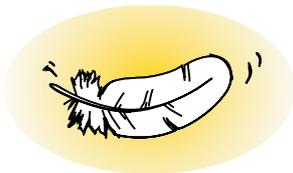


The weight of an air motor is several times less than corresponding electric motors.

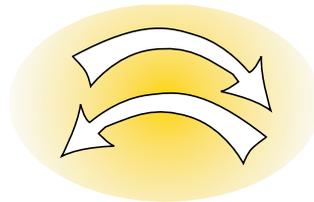

The motors are reversible as standard.

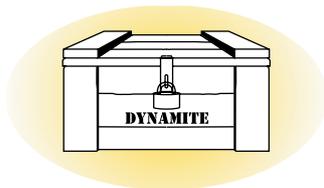


Air motors can be used in the harshest environments.

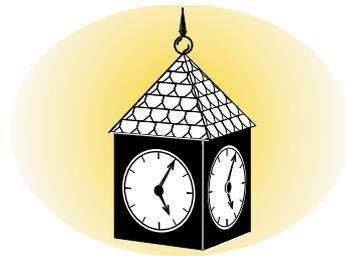


The reliability of air motors is very high, thanks to the design and the low number of moving parts.

Principles of air motor functioning

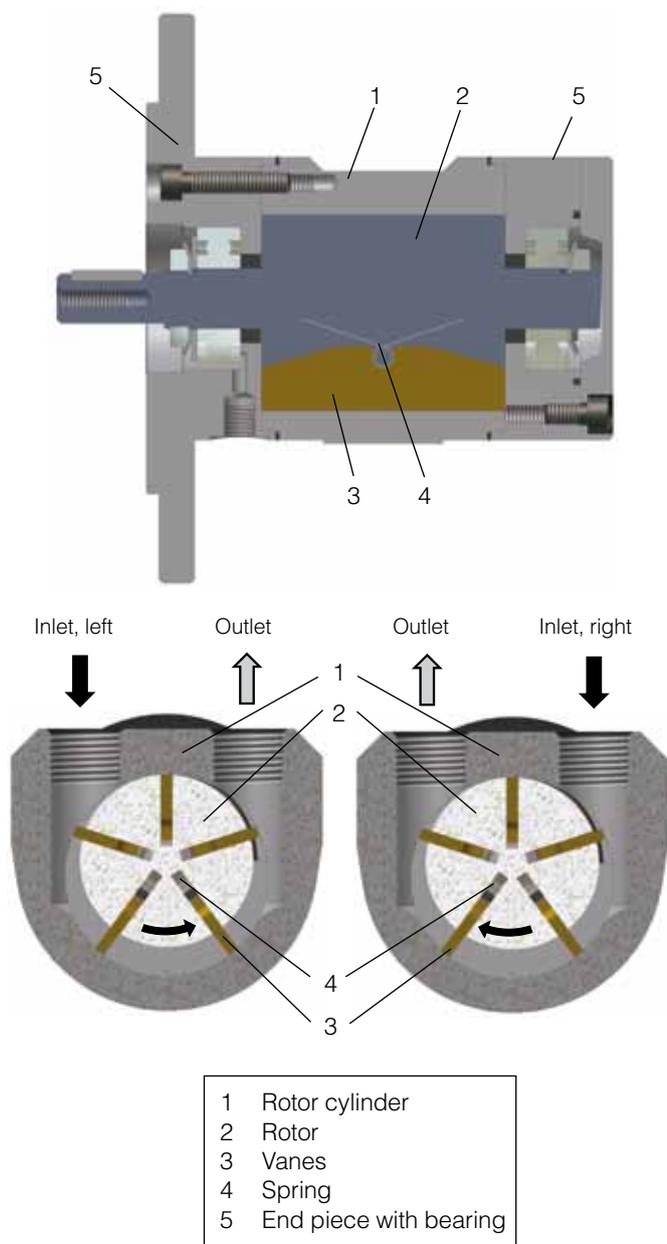

Torque, power and air consumption graphs

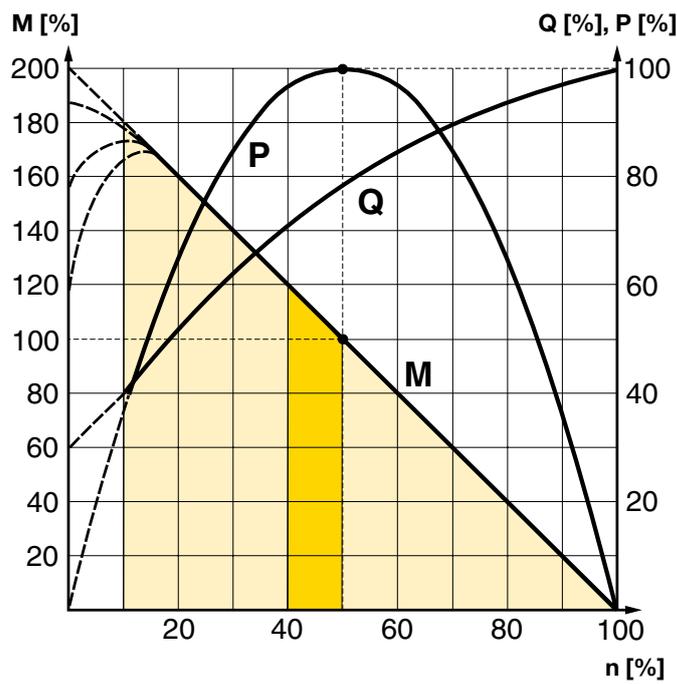

P = power
M = torque
Q = air consumption
n = speed

Possible working range of motor.

Optimum working range of motor.
Higher speeds = more vane wear
Lower speeds with high torque = more gearbox wear

There are a number of designs of air motor. Parker has chosen to use the vane rotor design, because of its simple design and reliable operation. The small external dimensions of vane motors make them suitable for all applications.

The principle of the vane motor is that a rotor with a number of vanes is enclosed in a rotor cylinder. The motor is supplied with compressed air through one connection and air escapes from the other connection. To give reliable starting, the springs press the vanes against the rotor cylinder. The air pressure always bears at right angles against a surface. This means that the torque of the motor is a result of the vane surfaces and the air pressure.

The performance characteristics of each motor are shown in a family of curves as above, from which torque, power and air consumption can be read off as a function of speed. Power is zero when the motor is stationary and also when running at free speed (100%) with no load. Maximum power (100%) is normally developed when the motor is driving a load at approximately half the free speed (50%).

Torque at free speed is zero, but increases as soon as a load is applied, rising linearly until the motor stalls. As the motor can then stop with the vanes in various positions, it is not possible to specify an exact torque. However, a minimum starting torque is shown in all tables.

Air consumption is greatest at free speed, and decreases with decreasing speed, as shown in the above diagram.

Choosing the correct air motor for your application**① Which drive principle of the air motor is suitable for your application?**

- Air vane motor are suitable for regular operating cycles, speed is very small e.g. 16 rpm
- Tooth gear air motor or turbines are more suitable for continuous operation, 24 hours non-stop, speed is in a upper range, up to 140,000 rpm
- Oil free operation is often an option for these three principles of air motors. Be aware that there is a reduction of performance between -10 to 20%.

② Which motor materials are suitable for your application?

- Will the air motor work in a normal production area
- Or in a paper industry
- Or in the food processing industry, in contact or not with food
- Or in underwater usage
- Or in the medical, pharmaceutical industries
- Or in potentially explosive areas
- Others, please describe your environment

③ How do you calculate the motor power taking the application conditions into consideration?

1. Which rotational direction? Clockwise, anti-clockwise, reversible?
2. Air pressure working range? Which air class quality is available?
3. Which torque and which speed under load do you expect to obtain?
4. Calculate the basic power with the formula

$$P = M \times n / 95550 \text{ with } P \text{ power output in kW, } M \text{ nominal torque in Nm, } n \text{ nominal speed in rpm}$$

5. Check performance data of air motors in our catalogues. Note that all data is at 6 bar in the inlet of the air motor, max 3 meters for tubes and oil lubricated operations.
6. To adapt the difference of air pressure with your operation conditions, please check graphs in our catalogues and how to do it.
7. or you can adapt the need of air to fit your operation conditions by throttling the outlet flow in the air motor you will reduce speed without loss of torque.
8. Check if you need an oil free or not working operation. 1 to 2 drops of oil per cube meter are needed to optimize performance and life time of air motors. Oil free operation will decrease by 10 to 20% the performance of air motors.

④ How do you integrate your air motor in your system?

- In which position is the air motor used?
- Do you need to use a brake?
- Do you want to use your own gear box and put it somewhere else in the machine?
- Do you need extra components like fittings, tubes, valves and FRLs?

⑤ How do you ensure a long life and high performance of the air motor?

- Ensure you air quality is in accordance with our specifications, oil or free oil lubrication operations.
- Keep the recommended maintenance intervals

⑥ How do you determine the purchasing and running costs after the air motor installation?

- Keep same level of your air quality.

Introduction


The performance of an air motor is dependent on the inlet pressure. At a constant inlet pressure, air motors exhibit the characteristic linear output torque / speed relationship. However, by simply regulating the air supply, using the techniques of throttling or pressure regulation, the output of an air motor can easily be modified. The most economical operation of an air motor (least wear, least air consumption, etc.) is reached by running close to nominal speed. By torque of $M = 0$, the maximum speed (idle speed) is reached. Shortly before standstill ($n = 0$), the air motor reaches its maximum torque ($M_{max} = 2 \times M_o$). At nominal speed (n_n), for example in the middle of the speed range, air motor reaches its maximum power output (P_{max}).

Energy Efficiency

A pneumatic motor achieves its maximum power when it is operating as close as possible to its rated speed (50% of the rated idle speed). The energy balance is best in this area, because the compressed air is used efficiently.

Air pressure correction factors

To adapt the difference of air pressure with your operation conditions

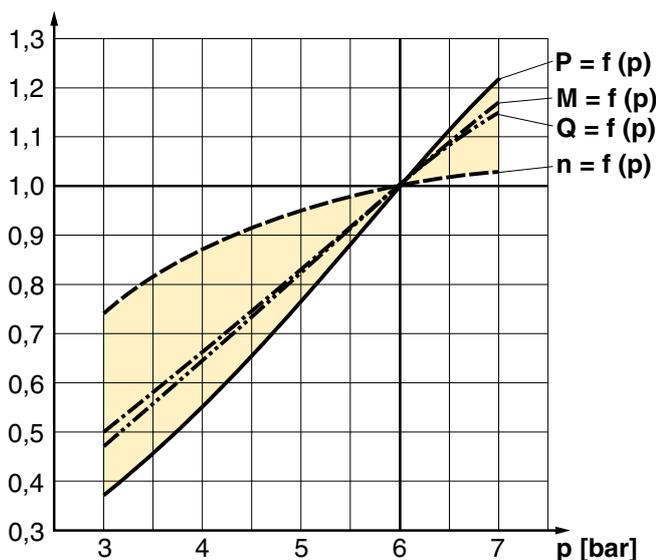


P = Power, M = Torque, Q = Air consumption, N = Speed

Pressure (p) bar / PSI	Power (P) %	Speed (n) %	Torque (M) %	Air Consumpt. (Q) %
7 / 99	121	103	117	117
6 / 85	100	100	100	100
5 / 71	77	95	83	83
4 / 57	55	87	67	67
3 / 42	37	74	50	50


All catalogue data and curves are specified at a supply pressure of 6 bar to the motor. This diagram shows the effect of pressure on speed, specified torque, power and air consumption. Start off on the curve at the pressure used and then look up to the lines for power, torque and air consumption. Read off the correction factor on the Y axis for each curve and multiply this by the specified catalogue data in the table, or data read from the torque and power graphs.

Example: at 4 bar supply pressure, the power is only 0.55 x power at 6 bar supply pressure. This example shows how strongly power falls if supply pressure is reduced. You must therefore ensure that the motor is supplied through pipes of sufficient diameter to avoid pressure drop.

The speed and torque can also be regulated by installing a pressure regulator in the inlet pipe. This means that the motor is constantly supplied with air at lower pressure, which means that when the motor is braked, it develops a lower torque on the output shaft.

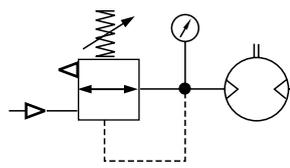


Pressure regulation at motor inlet.

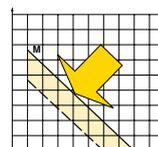





Torque curve change caused by pressure change

Speed regulation, air flow reduction

Every size reduction or restriction on the air line, whether of the supply hose itself or fittings, before the air motor affects the amount of the supplied air. By throttling you reduce the speed of your motor and simultaneously, the required torque. That means that you reduce the motor performance. The most common way to reduce the speed of a motor is to install a flow control valve in the air outlet, you can set the speed without loss of the torque. When the motor is used in applications where it must reverse and it is necessary to restrict the speed in both directions, flow control valves with by-pass should be used in both directions. If the inlet air is restricted, the air supply is restricted and the free speed of the motor falls, but there is full pressure on the vanes at low speeds. This means that we get full torque from the motor at low speeds despite the low air flow. Since the torque curve becomes "steeper", this also means that we get a lower torque at any given speed than would be developed at full air flow. The benefit of throttling the inlet is that air consumption is reduced, whereas throttling the exhaust air maintains a slightly higher starting torque.

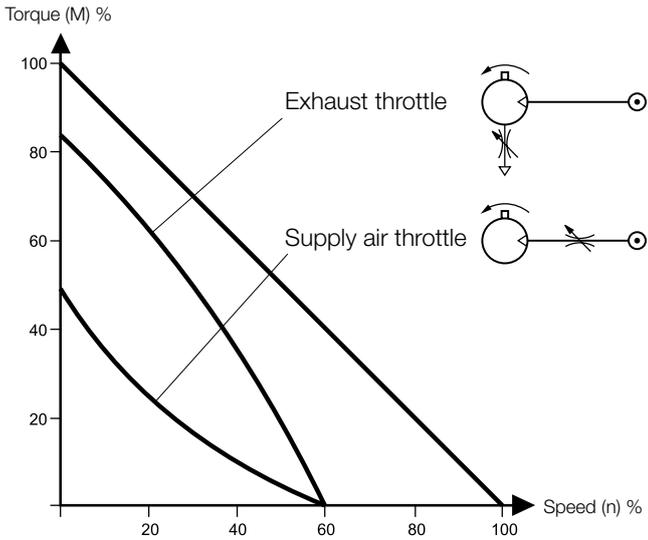


Throttling

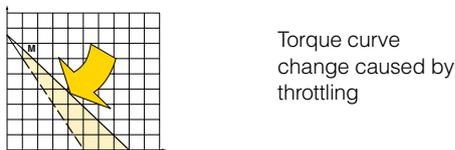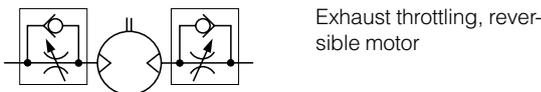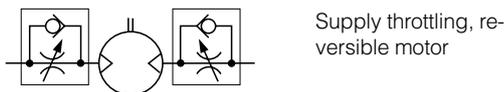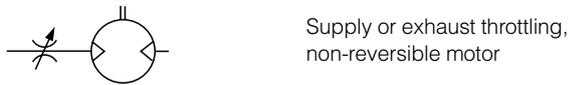

Component choice for air supply

Direction of motor rotation

The direction of rotation of reversible motors is obtained by supplying inlet L or inlet R with compressed air. The motor can be stopped and started continually without damage occurring.

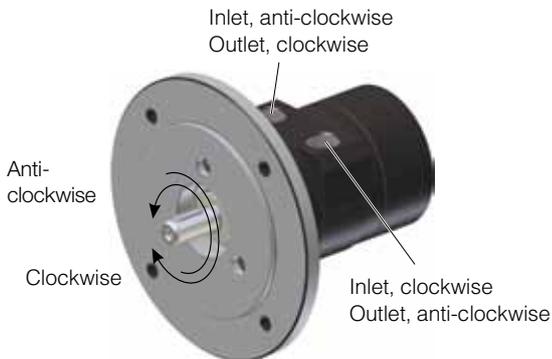

Reversible means in both directions.

Compressed air quality

Oil and oil mist are avoided whenever possible to ensure a clean work environment. In addition, purchasing, installation and maintenance of oil equipment can be expensive. All users in all industries now try to avoid using components which have to be lubricated. The P1V air motors series are equipped with vanes for intermittent lubrication free operation as standard, which is the most common application of air motors.

Oil mist



If oil mist is used (approx. 1 drop of oil per m³ of compressed air), the oil not only acts as a lubricant but also protects against corrosion. This means that compressed air with a certain water content may be used without causing corrosion problems inside the motor. ISO8573-1 purity class 3.-.5 may be used without difficulty. The following oils are recommended for use in the food stuffs industry: Klüberoil 4 UH 1-32

ISO 8573-1 purity classes

Quality class	Contaminants		Water max. pressure dew point (°C)	Oil max. concentration (mg.m ³)
	particle size (µm)	max. concentration (mg/m ³)		
1	0.1	0.1	-70	0.01
2	1	1	-40	0.1
3	5	5	-20	1.0
4	15	8	+3	5.0
5	40	10	+7	25
6	-	-	+10	-

For example: compressed air to purity class 3.4.3. This means a 5 µm filter (standard filter), dew point +3°C (refrigerant cooled) and an oil concentration of 1,0 mg oil/m³ (as supplied by a standard compressor with a standard filter).



Air supply

Since the supply pressure at the air motor inlet port is of considerable importance for obtaining the power, speed and torque quoted in the catalogue, the recommendations below should be observed.


The following data must be complied with:

- Supply pressure: 7 bar
- Regulator pressure setting: 6.7 bar
- Pipe length between air treatment unit and valve: max. 1 m
- Pipe length valve and air motor: max 2 m


The pressure drop through the air preparation unit, pipe, valve means that 6 bar pressure is obtained at the motor supply port. Please refer to the correction diagram and factors to see what lower supply pressure means for power, speed and torque.

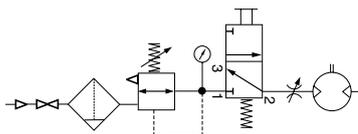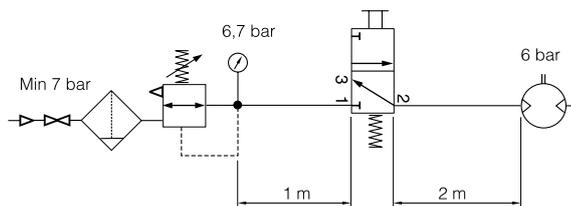

Shut-off, filtering, pressure regulation and control valve

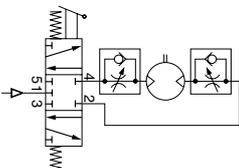

Reversible motor with 5/3 control valve

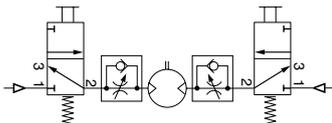

Reversible motor with two 3/2 control valves

The air with which the motor is supplied must be filtered and regulated. Directional valves are needed to provide it with air, to get the motor to rotate when we want it to. These valves can be equipped with several means of actuation, such as electric, manual and pneumatic control. When the motor is used in a non-reversible application, it is sufficient to use a 2/2 or 3/2 valve function for supply. Either one 5/3 or two 3/2 valves functions are needed for a reversible motor, to ensure that the motor receives compressed air and the residual air outlet is vented. A flow control valve can be installed in the supply pipe to regulate the motor speed if the motor is not used as a reversible motor.


One flow control valve with by-pass is needed to regulate each direction of rotation if the motor is used as a reversible motor. The built-in check valve will then allow air from the residual air outlet to escape through the outlet port in the control valve. The compressed air supply must have sufficiently large pipes and valves to give the motor the maximum power. The motor needs 6 bar at the supply port all the time. For example, a reduction of pressure to 5 bar reduces the power developed to 77% and to 55% at 4 bar!

Silencing

Exhaust silencer



Central silencer

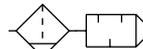

The noise from an air motor consists of both mechanical noise and a pulsating noise from the air flowing out of the outlet. The installation of the motor has a considerable effect on mechanical noise. It should be installed so that no mechanical resonance effects can occur. The outlet air creates a noise level which can amount to 115 dB(A) if the air is allowed to exhaust freely into the atmosphere. Various types of exhaust silencers are used to reduce this level. The most common type screws directly onto the exhaust port of the motor. Since the motor function causes the exhaust air to pulsate, it is a good idea to allow the air to exhaust into some kind of chamber first, which reduces the pulsations before they reach the silencer. The best silencing method is to connect a soft plastic hose to a large central silencer with the largest possible area, to reduce the speed of the out-flowing air as far as possible.

NOTE! Remember that if a silencer which is too small or is blocked, generates back pressure on the outlet side of the motor, which reduces the motor power.

CE marking


The air motors are supplied as “Components for installation” – the installer is responsible for ensuring that the motors are installed safely in the overall system. Parker Pneumatic guarantees that its products are safe, and as a supplier of pneumatic equipment we ensure that the equipment is designed and manufactured in accordance with the applicable EU directive.

Most of our products are classed as components as defined by various directives, and although we guarantee that the components satisfy the fundamental safety requirements of the directives to the extent that they are our responsibility, they do not usually carry the CE mark.

The following are the currently applicable directives:

- Machinery Directive(essential health and safety requirements relating to the design and structure of machines and safety components)
- EMC Directive
- Simple Pressure Vessels Directive
- Low Voltage Directive
- ATEX Directive (ATEX = ATmosphere EXplosive)

Torque, power and air consumption graphs

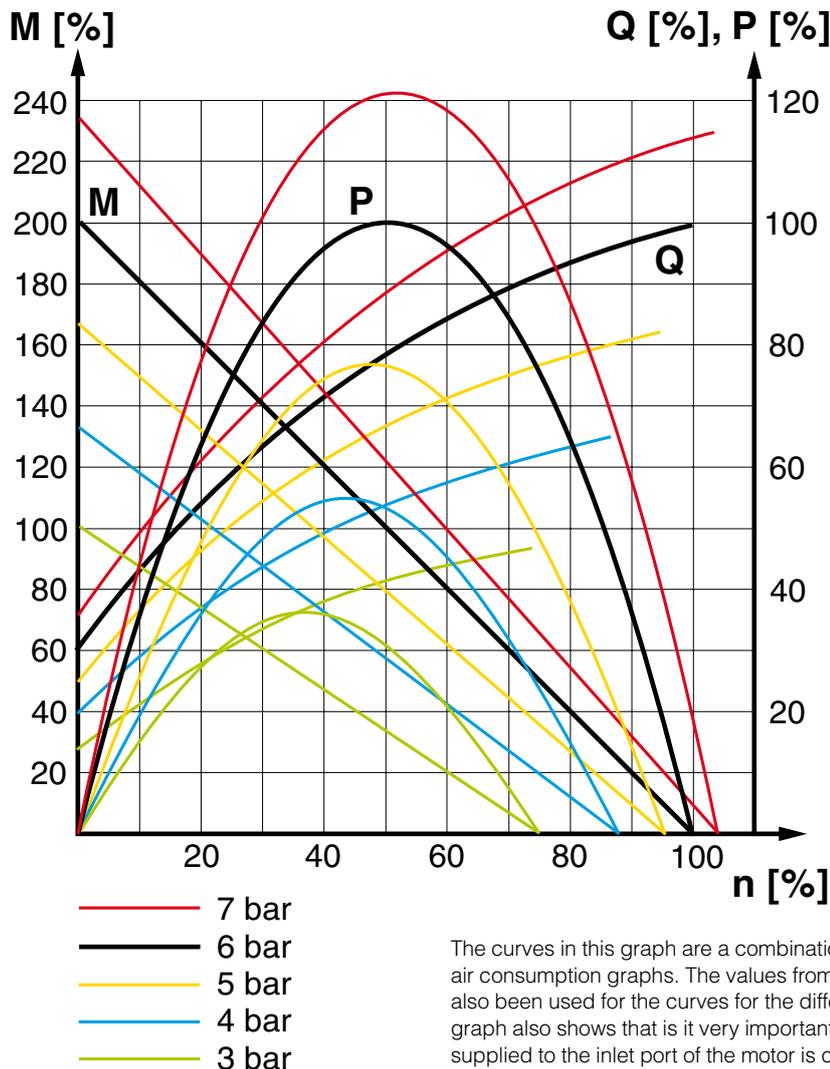

P = power	Q = air consumption
M = torque	n = speed

The curves in this graph are a combination of the torque, power and air consumption graphs. The values from the correction diagram have also been used for the curves for the different pressure values. The graph also shows that it is very important to ensure that the pressure supplied to the inlet port of the motor is correct, in order to allow the motor to work at maximum capacity. If the valve supplying a large motor is too small, or if the supply line is underspecified, the pressure at the inlet port may be so low that the motor is unable to do its work. One solution would be to upgrade the valve and supply system, or alternatively you could replace the motor with a smaller motor with lower air consumption. The result would be increased pressure at the inlet port, which means that the smaller motor could carry out the necessary work. However, you may need to select a smaller motor with a lower free speed in order to obtain sufficient torque at the outgoing shaft.

Choice of an air motor, general

The motor to be used should be selected by starting with the torque needed at a specific spindle speed. In other words, to choose the right motor, you have to know the required speed and torque. Since maximum power is reached at half the motor's free speed, the motor should be chosen so that the point aimed at is as close as possible to the maximum power of the motor. The design principle of the motor means that higher torque is generated when it is braked, which tends to increase the speed. This means that the motor has a kind of speed selfregulation function built in. Use the following graph to choose the correct motor size and the correct type of gear as appropriate. The graph contains the points for the maximum torque of each motor at maximum power. Put in your point on the graph and select a marked point above and to the right of the point you need.

Then check the characteristic graph of each motor to find more accurate technical data. Always select a motor where the data required is in the orange field. Also use the correction diagram to see what it would mean to use different air supply pressures or different air flow in the motor.

Tip: Select a motor which is slightly too fast and powerful, regulate its speed and torque with a pressure regulator and/or restriction to achieve the optimum working point.

Do you need any support to select the right air motor, please feel free to consult your local sales office.

Specifying air quality (purity) in accordance with ISO8573-1:2010, the international standard for Compressed Air Quality

ISO8573-1 is the primary document used from the ISO8573 series as it is this document which specifies the amount of contamination allowed in each cubic metre of compressed air.

ISO8573-1 lists the main contaminants as Solid Particulate, Water and Oil. The purity levels for each contaminant are shown separately in tabular form, however for ease of use, this document combines all three contaminants into one easy to use table.

ISO8573-1:2010 CLASS	Solid Particulate			Mass Concentration mg/m ³	Water		Oil
	Maximum number of particles per m ³				Vapour Pressure Dewpoint	Liquid g/m ³	Total Oil (aerosol liquid and vapour) mg/m ³
	0,1 - 0,5 micron	0,5 - 1 micron	1 - 5 micron				
0	As specified by the equipment user or supplier and more stringent than Class 1						
1	≤ 20 000	≤ 400	≤ 10	-	≤ -70 °C	-	0,01
2	≤ 400 000	≤ 6 000	≤ 100	-	≤ -40 °C	-	0,1
3	-	≤ 90 000	≤ 1 000	-	≤ -20 °C	-	1
4	-	-	≤ 10 000	-	≤ +3 °C	-	5
5	-	-	≤ 100 000	-	≤ +7 °C	-	-
6	-	-	-	≤ 5	≤ +10 °C	-	-
7	-	-	-	5 - 10	-	≤ 0,5	-
8	-	-	-	-	-	0,5 - 5	-
9	-	-	-	-	-	5 - 10	-
X	-	-	-	> 10	-	> 10	> 10

Specifying air purity in accordance with ISO8573-1:2010

When specifying the purity of air required, the standard must always be referenced, followed by the purity class selected for each contaminant (a different purity class can be selected for each contamination if required).

An example of how to write an air quality specification is shown below:

ISO 8573-1:2010 Class 1.2.1

ISO 8573-1:2010 refers to the standard document and its revision, the three digits refer to the purity classifications selected for solid particulate, water and total oil. Selecting an air purity class of 1.2.1 would specify the following air quality when operating at the standard's reference conditions :

Class 1 - Particulate

In each cubic metre of compressed air, the particulate count should not exceed 20,000 particles in the 0.1 - 0.5 micron size range, 400 particles in the 0.5 - 1 micron size range and 10 particles in the 1 - 5 micron size range.

Class 2 - Water

A pressure dewpoint (PDP) of -40°C or better is required and no liquid water is allowed.

Class 1 - Oil

In each cubic metre of compressed air, not more than 0.01mg of oil is allowed. This is a total level for liquid oil, oil aerosol and oil vapour.

ISO8573-1:2010 Class zero

- Class 0 does not mean zero contamination.
- Class 0 requires the user and the equipment manufacturer to agree contamination levels as part of a written specification.
- The agreed contamination levels for a Class 0 specification should be within the measurement capabilities of the test equipment and test methods shown in ISO8573 Pt 2 to Pt 9.
- The agreed Class 0 specification must be written on all documentation to be in accordance with the standard.
- Stating Class 0 without the agreed specification is meaningless and not in accordance with the standard.
- A number of compressor manufacturers claim that the delivered air from their oil-free compressors is in compliance with Class 0.
- If the compressor was tested in clean room conditions, the contamination detected at the outlet will be minimal. Should the same compressor now be installed in typical urban environment, the level of contamination will be dependent upon what is drawn into the compressor intake, rendering the Class 0 claim invalid.
- A compressor delivering air to Class 0 will still require purification equipment in both the compressor room and at the point of use for the Class 0 purity to be maintained at the application.
- Air for critical applications such as breathing, medical, food, etc typically only requires air quality to Class 2.2.1 or Class 2.1.1.
- Purification of air to meet a Class 0 specification is only cost effective if carried out at the point of use.




Large Air Motors

P1V-A: 1.6, 2.6 & 3.6 kW

Contents	Page
Large Air Motors.....	15
Material and technical specification.....	16
Large Air Motors without gear boxes, 1600, 2600 & 3600 watts	18
Torque and power graphs	18
Permitted shaft loadings	18
Dimensions.....	19 - 20
Holding brakes.....	21
Large Air Motors with planetary gear boxes, 1600, 2600 & 3600 watts	22 - 23
Permitted shaft loadings	23
Torque and power graphs	24
Dimensions.....	25
Large Air Motors with helical gear boxes, 1600, 2600 & 3600 watts	26 - 27 & 29
Dimensions.....	28 & 30
Torque and power graphs	31 - 32
Permitted shaft loadings	33
Large Air Motors with worm gear boxes, 1600, 2600 & 3600 watts.....	34 - 35 & 37 & 39
Dimensions.....	36 & 38 & 40
Torque and power graphs	41 - 42
Permitted shaft loadings	43
Shaft with keys for P1V-A with worm gear boxes	44
Order model code	45
Lubrication and service life	46

P1V-A Large Air Motors

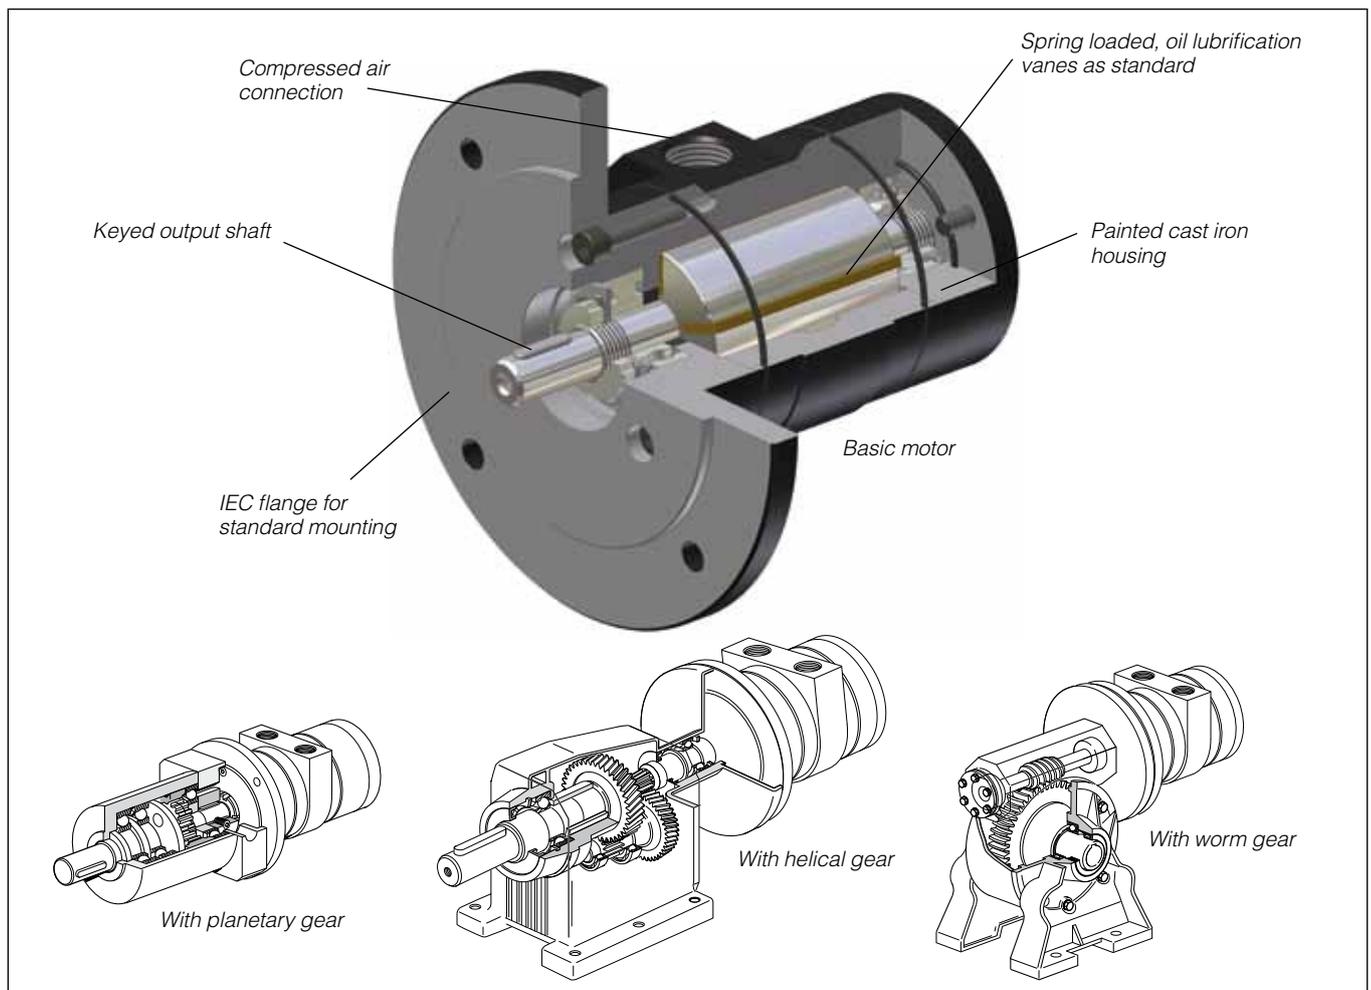

Large Air Motors

P1V-A is a range of reversible air motors intended for heavy and demanding applications. The motor housings are made from painted cast iron, and the components sealed to permit operation in damp and dirty environments.

The range contains three different sizes, P1V-A160, P1V-A260 and P1V-A360, with power ratings of 1600, 2600 or 3600 Watts. The basic motors can be supplied with built-in gearboxes, either planetary, helical or worm drives, to provide the correct speed of rotation and torque, and the correct installation mountings.

Basic motors

All pneumatic motors are equipped with spring loaded vanes as standard, which gives the motors very good starting and low speed running characteristics. They are also equipped with vanes for intermittent or permanent oil lubrication as standard. The simple construction of the motors makes them very reliable, with long service life and they are easy to service.

Motors with planetary gears

A P1V-A combined with a planetary gear has small installation dimensions, low weight in relation to performance, free installation position, flange mounting as standard, in line output shaft and high efficiency. They are available with shaft speeds ranging from 95 rpm to 1200 rpm, with torques ranging from 16 Nm to 160 Nm.

Motors with helical gears

A P1V-A combined with a helical gear has high efficiency, simple installation with flange or foot, and competitive pricing. They are available with shaft speeds ranging from 25 rpm to 1050 rpm, with torques ranging from 23 Nm to 1800 Nm. Oil-bath gears mean that the installation position must be decided beforehand. The installation position governs the amount of oil in the gear and the location of filling and drain plugs.

Motors with worm gears

A P1V-A combined with a worm drive gear has the following characteristics: gearboxes with high gear ratios are self-locking, which means that they can be used to maintain the output shaft in position, simple installation with the flange on the left or right sides or with a foot, small installation dimensions and competitive pricing. They are available with shaft speeds ranging from 62 rpm to 500 rpm, with torques ranging from 38 Nm to 670 Nm. Oil-bath gears mean that the installation position must be decided beforehand. The installation position governs the amount of oil in the gear and the location of filling and drain plugs.



Products specially designed for mobile applications

P1V-A Large Air Motors

Technical data

Note: All technical data are based on a working pressure of 6 bar and with oil. Speed tolerance accuracy in between clock and anti-clockwise directions is $\pm 10\%$.

Air motor size & type	P1V-A160	P1V-A260	P1V-A360
Nominal power (watts)	1600	2600	3600
Working pressure (bar)	3 to 7, 6 in explosive atmosphere		
Working temperature (°C)	-30 to +100		
Ambient temperature (°C)	-20 to +40 in explosive atmosphere		
Air flow required (NI/min)	1900	3600	5800
Min pipe ID, inlet (mm)	15	19	25
Min pipe ID, outlet (mm)	15	19	25
Choice of treatment unit: recommended min air flow (l/min) at p1 7.5 bar and 0.8 bar pressure drop			
	2100	3900	6200
Choice of valve: recommended min nominal air flow (l/min) at p1 6 bar and 1 bar pressure drop			
	2300	4200	6600
Medium	40µm filtered, oil mist or dry unlubricated compressed air		
Oil operation	1-2 drop per cube meter, ISO8573-1 purity class 3.-.5		
Recommended oil	Foodstuffs industry Klüberoil 4 UH 1-32		
Sound level free outlet (dB(A))	120	131	131
With outlet silencer (dB(A))	97.5	99	101

Note: sound levels are measured at free speed with the measuring instrument positioned 1 meter away from the air motor at an height of 1 meter.


Material specification

Air motor size & type	P1V-A160	P1V-A260	P1V-A360
Without gear box			
Motor housing	Cast iron, synthetic paint, black color		
Shaft	High grade steel		
Key	Hardened steel		
External seal	Nitrile rubber, NBR		
Internal steel parts	High grade steel		
Motor lubrication	Foodstuffs industry Klüber oil 4 UH 1-32		
Vanes	Patented, no data		
Screws	Zinc coated steel		
With gear boxes, common data			
Housing	Alloy steel, synthetic paint, black color		
Shaft	Hardened steel		
Key	Hardened steel		
Shaft seal	Nitrile rubber, NBR		
Screws	Zinc coated steel		
With planetary gear box			
Housing	Cast iron, synthetic paint, black color		
With helical gear box			
Housing	Aluminium or cast iron, synthetic paint, black color		
With worm gear box			
Housing	Aluminium or cast iron, synthetic paint, black color		
Pinion	Chili cast phosphor bronze		
Worm	Alloyed, hardened steel		

Design data

Motor without gear box	With planetary gear box	With helical gear box	With worm gear box
<p>Robust design with few components:</p> <ul style="list-style-type: none"> • Spring loaded vanes as standard give good starting and low speed characteristics • Keyed output shaft • Reversible operation 	<p>Precision made gears with efficiency over 95%</p> <ul style="list-style-type: none"> • Sealed, permanently grease lubrication gives free installation position • Compact installation and low weight • Central output shaft 	<ul style="list-style-type: none"> • Two versions available, with flange or foot • High efficiency, 90 to 95% • Oil-bath gearboxes mean that the installation position must be decided in advance. The installation position determines the volume of oil in the gearbox and location of oil filling and drain plugs. 	<ul style="list-style-type: none"> • Available in three versions, for installation with left-hand flange, right-hand flange or foot mounting. • Compact size and low weight • Self-locking in higher ratios • Output shaft at 90° angle to motor spindle • Hollow output shaft with key slot. Single-ended or "through" twin shaft as options. • Oil-bath gearboxes mean that the installation position must be decided in advance. The installation position determines the volume of oil in the gearbox and location of oil filling and drain plugs.

NOTE! All technical data are based on a working pressure of 6 bar and with oil.
Speed tolerance accuracy is $\pm 10\%$.

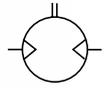


A: Basic reversible motor without gear box, IEC Flange

For ATEX air motors consult your local sales office


Max power	Free speed*	Nominal speed	Nominal torque	Min start torque	Air consumption at max power	Con-nection	Min pipe ID inlet/ outlet	Weight	Order code
kW	rpm	rpm	Nm	Nm	l/s		mm	Kg	
1,600	9000	4500	3,3	5,0	32	G1/2	15	4,2	P1V-A160A0900
2,600	7000	3500	7,1	11,0	60	G3/4	19	7,9	P1V-A260A0700
3,600	6000	3000	11,5	17,0	97	G1	25	16,5	P1V-A360A0600

* maximum admissible speed (idling)


P1V-A160A0900

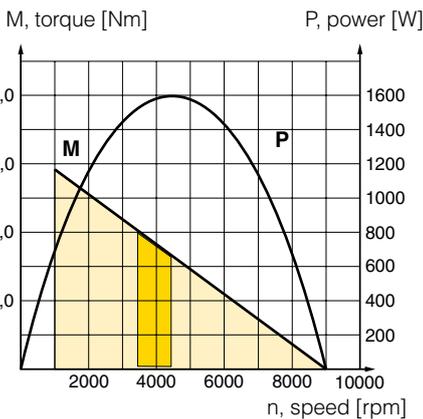

P1V-A260A0700

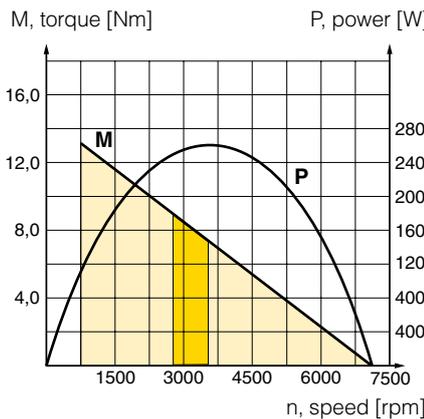

P1V-A360A0600

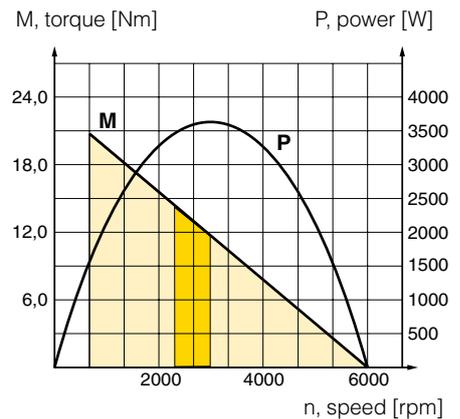

- Possible working range of motor.
- Optimum working range of motor.
Higher speeds = more vane wear
Lower speeds with high torque = more gearbox wear

Permitted shaft loadings

Max permitted load on output shaft for basic motors (based on 10,000,000 revolutions of the output shaft, with 90% probable service life for ball bearings).

	F_{ax} N	F_{rad} N	a mm
P1V-A160A0900	600	1000	15
P1V-A260A0700	700	1400	20
P1V-A360A0600	900	1900	25

F_{rad} = Radial loading (N)
 F_{ax} = Axial loading (N)


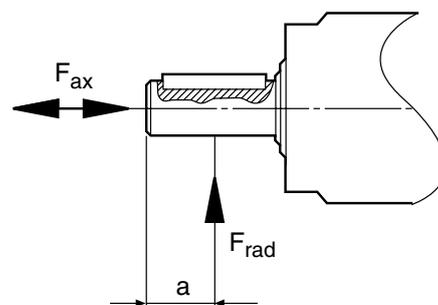



Fig. 1: Loading on output shaft.

Dimensions (mm)

Motor P1V-A160A0900
Flange IEC 71 A B5

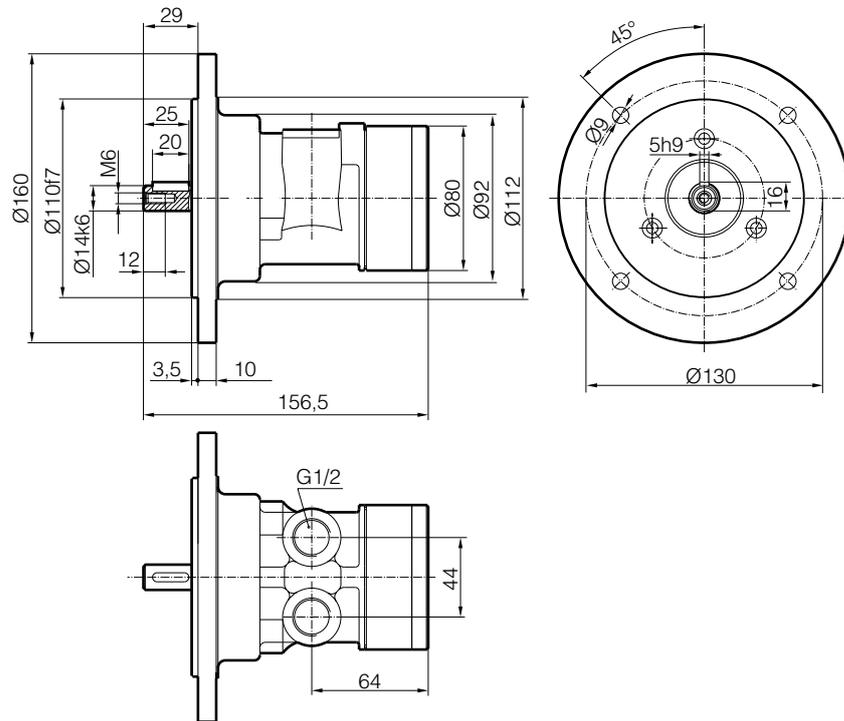


Motor P1V-A260A0700
Flange IEC 80 A B5

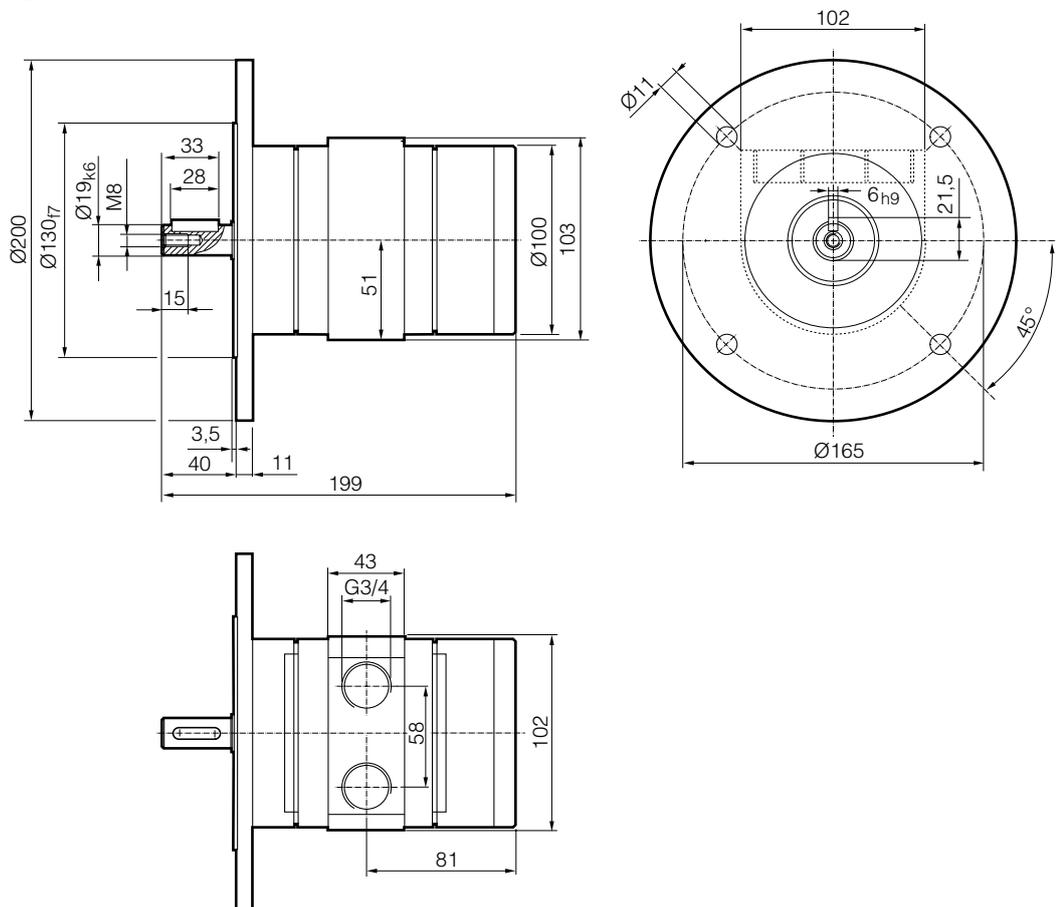

Dimensions (mm)

Motor P1V-A360A0600

Flange IEC 90 A B5

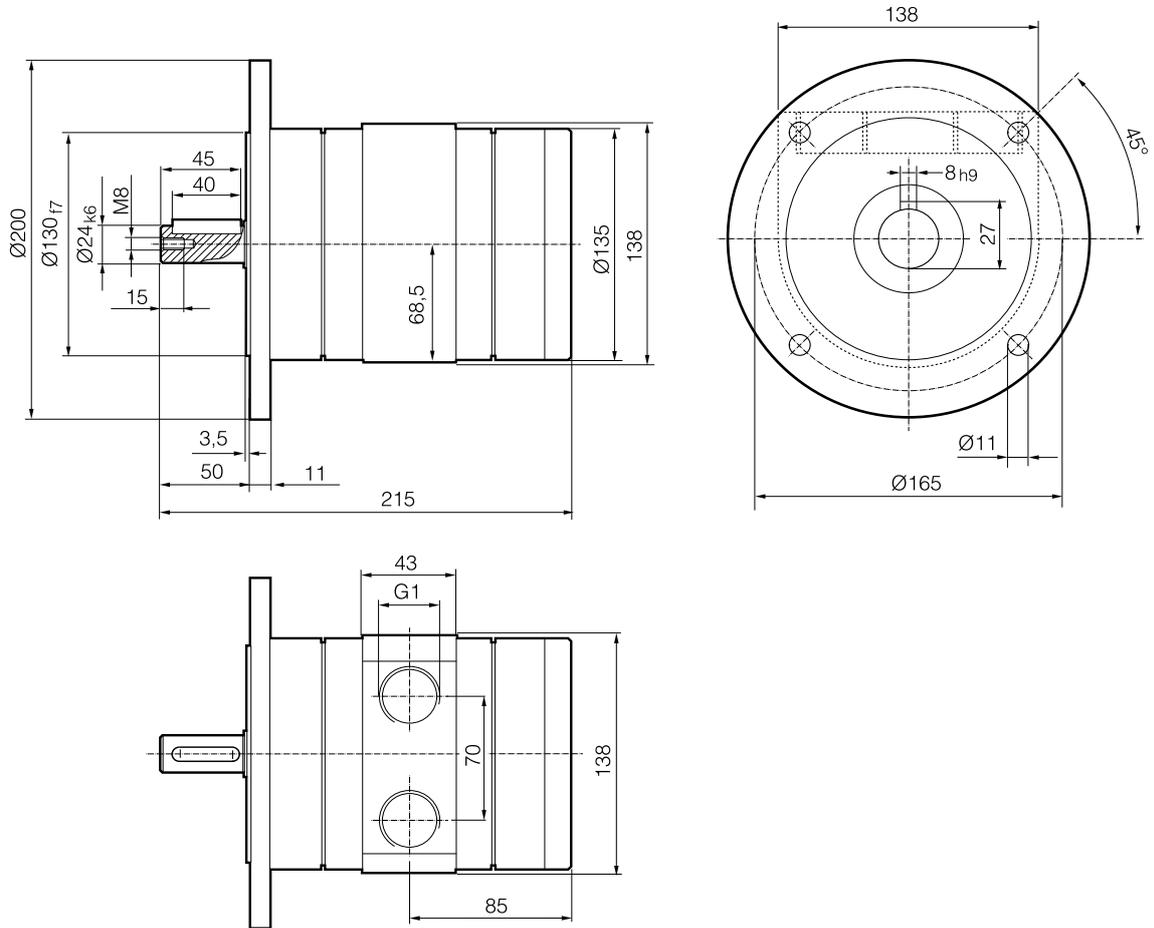


Holding Brakes

Our holding brakes are designed for the motors without gear boxes only.

For motor without gear box	Type	P1V-A160A0900	P1V-A260A0700	P1V-A360A0600
Holding brake	Order code	P1V-A/445709B	P1V-A/445711B	P1V-A/445713B
Brake Torque		12 Nm*)	28 Nm*)	46 Nm*)

*) The holding brake is not designed for use with a different drive system. Please only use it in combination with the stated motor types.

Dimensions (mm)


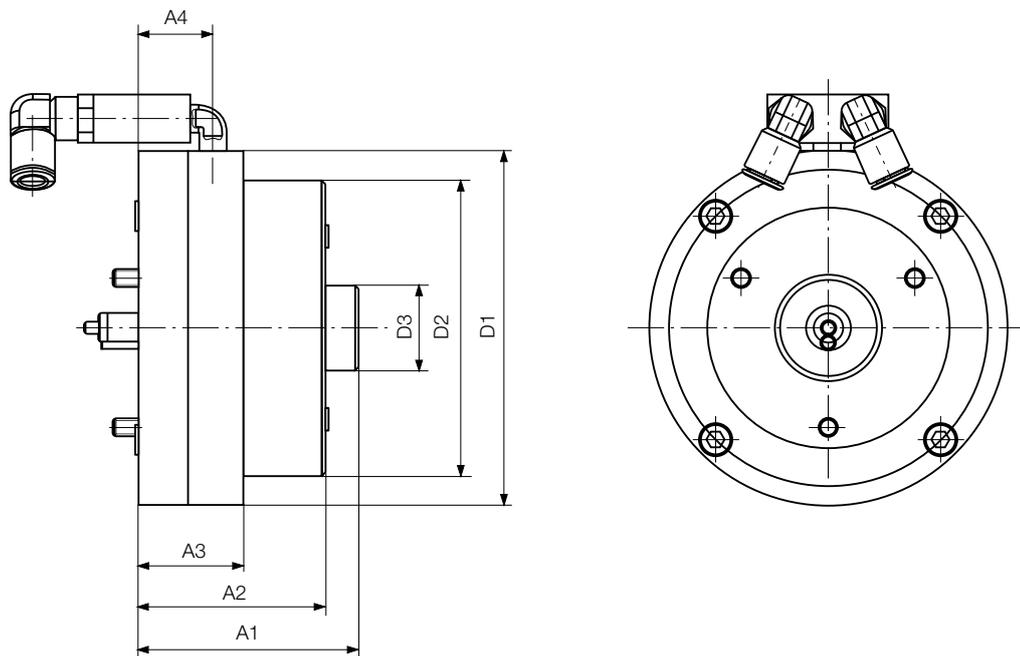


Dimensions of the braking device (mm)

Order code	A1	A2	A3	A4	D1	D2	D3
P1V-A/445709B	72.5	61.5	34.5	24.5	118	98	28
P1V-A/445711B	107	98	43.5	35.5	190	162	28
P1V-A/445713B							

Choice of an air motor with planetary gear

Nominal torque (Nm)

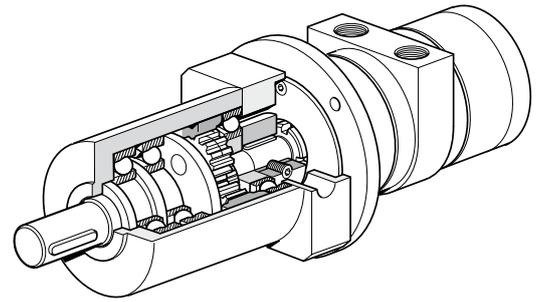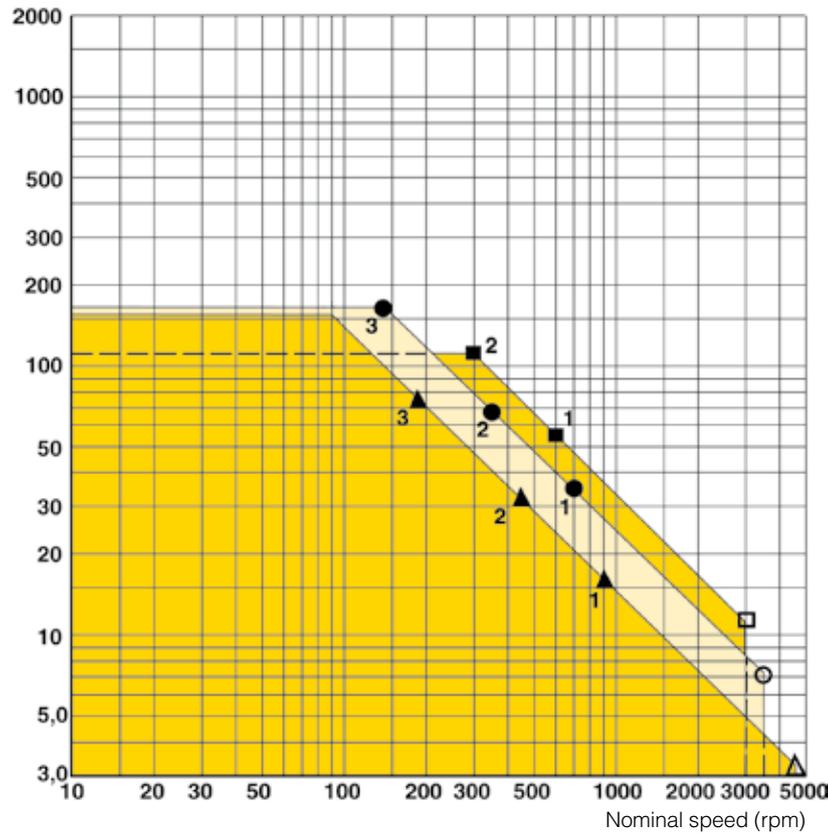

The motor to be used should be selected by starting with the torque needed at a specific spindle speed. In other words, to choose the right motor, you have to know the required speed and torque. Since maximum power is reached at half the motor's free speed, the motor should be chosen so that the point aimed at is as close as possible to the maximum power of the motor.

The design principle of the motor means that higher torque is generated when it is braked, which tends to increase the speed, etc. This means that the motor has a kind of speed self-regulation function built in.

Use the following graph to choose the correct motor size and the correct type of gear as appropriate. The graph contains the points for the maximum torque of each motor at maximum power. Put in your point on the graph and select a marked point above and to the right of the point you need.

Then check the characteristic graph of each motor to find more accurate technical data. Always select a motor where the data required is in the grey field. Also use the correction diagram to see what it would mean to use different air supply pressures with the motor.

Tip: Select a motor which is slightly too fast and powerful, regulate its speed and torque with a pressure regulator and/or restriction to achieve the optimum working point.

Choice of motors with planetary gears

Planetary gears are characterised by high efficiency, low moment of inertia and can offer high gear ratios.


The output shaft is always in the centre of the gearbox. Small installation dimensions relative to the torque provided. The gears are lubricated by grease, which means that it can be installed in all conceivable positions.

- Small installation dimensions
- Free installation position
- Simple flange installation
- Low weight
- Output shaft in centre
- High efficiency

Air motors in diagram above

- △ P1V-A160A0900
- ▲ 1 P1V-A160B0120
- ▲ 2 P1V-A160B0060
- ▲ 3 P1V-A160B0019
- P1V-A260A0700
- 1 P1V-A260B0120
- 2 P1V-A260B0060
- 3 P1V-A260B0019
- P1V-A360A0600
- 1 P1V-A360B0096
- 2 P1V-A360B0048

NOTE! All technical data are based on a working pressure of 6 bar and with oil.
Speed tolerance accuracy is $\pm 10\%$.

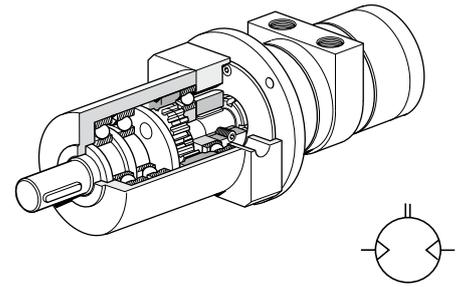

B: Reversible motor with planetary gear, flange mounting, free installation position

Max power kW	Max speed* rpm	Nominal speed rpm	Nominal Torque Nm	Min start torque Nm	Max permanent torque** Nm	Air consumption at max power l/s	Connection	Min pipe ID inlet/outlet mm	Weight Kg	Order code
Series P1V-A160										
1,600	1200	900	16	24	40	32	G1/2	15	8,3	P1V-A160B0120
1,600	600	450	32	48	35	32	G1/2	15	8,3	P1V-A160B0060
1,600	190	180	77	115	100	32	G1/2	15	15,4	P1V-A160B0019
Series P1V-A260										
2,600	1200	700	34	51	40	60	G3/4	19	12,0	P1V-A260B0120
2,600	600	350	67	100	40	60	G3/4	19	12,0	P1V-A260B0060
2,600	190	140	160	240	40	60	G3/4	19	13,0	P1V-A260B0019
Series P1V-A360										
3,600	960	600	55	82	100	97	G1	25	25,5	P1V-A360B0096
3,600	480	300	110	165	100	97	G1	25	25,5	P1V-A360B0048

* maximum admissible speed (idling)

** Max gear box torque for a permanent load

Permitted shaft loadings

The following calculations should be used to determine the loading on the output shaft bearing, if a service life of 10,000,000 revolutions of the output shaft is to be obtained with 90% probability.

$$F_{ax} = \max 0,24 \times F_{rad}$$

$$M = \pm F_{ax} \times r \pm F_{rad} \times (X + K)$$

Where M and K are found in the table below

	M Nm	K N
P1V-A160B120	2651	0,031
P1V-A160B060	2651	0,031
P1V-A160B019	7385	0,040
P1V-A160B010	7385	0,040
P1V-A260B120	2651	0,031
P1V-A260B060	2651	0,031
P1V-A260B019	7385	0,040
P1V-A360B096	7385	0,040
P1V-A360B048	7385	0,040

- M Max. torque loading on output shaft (Nm)
- r Distance from centre of output shaft to axial load (m)
- X Distance from collar to radial load (m)
- F_{rad} Radial loading (N)
- F_{ax} Axial loading (N)



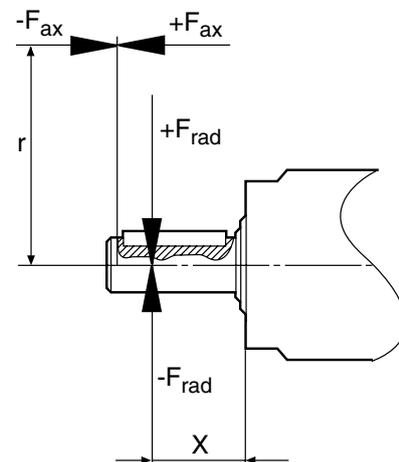


Fig 2: Load and braking torque on output shaft of planetary gear


P1V-A160B0120

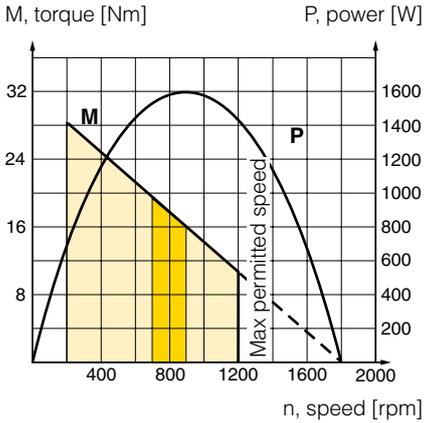


P1V-A160B0060

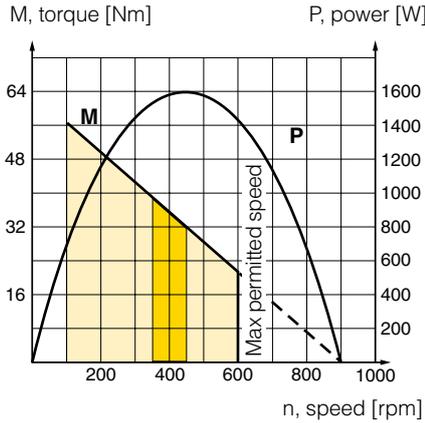


P1V-A160B0019

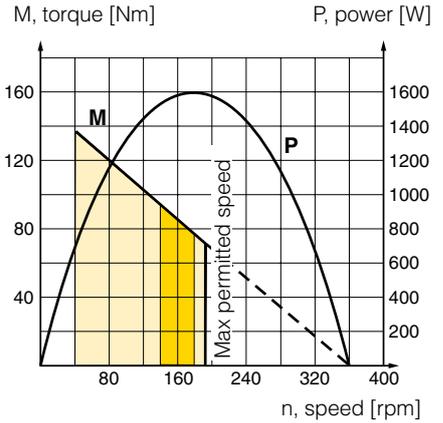


P1V-A260B0120

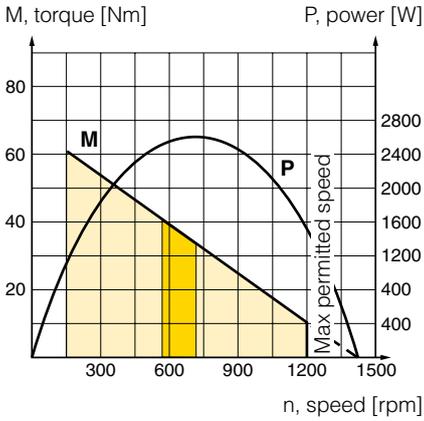


P1V-A260B0060

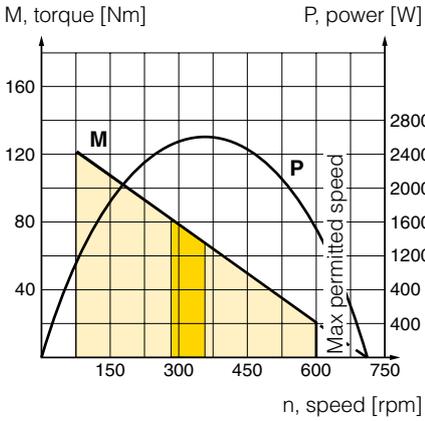


P1V-A260B0019

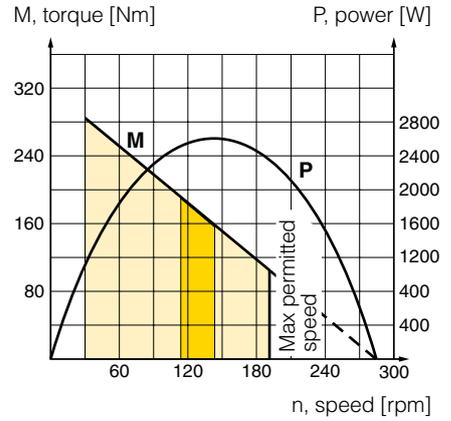

P1V-A360B0096

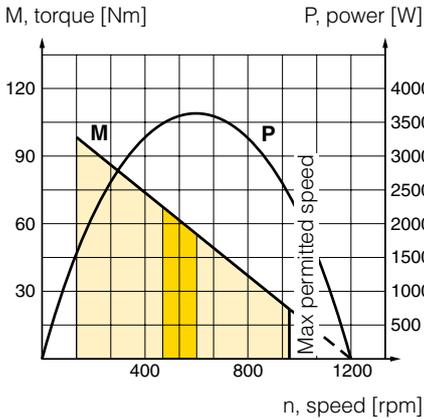


P1V-A360B0048

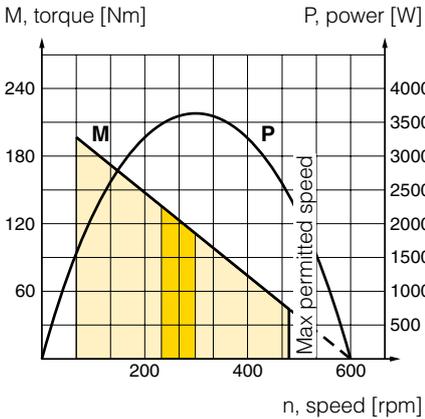

Possible working range of motor.
 Optimum working range of motor.
 Higher speeds = more vane wear
 Lower speeds with high torque = more gearbox wear

Dimensions (mm)

B: Motor with planetary gear, flange mounting


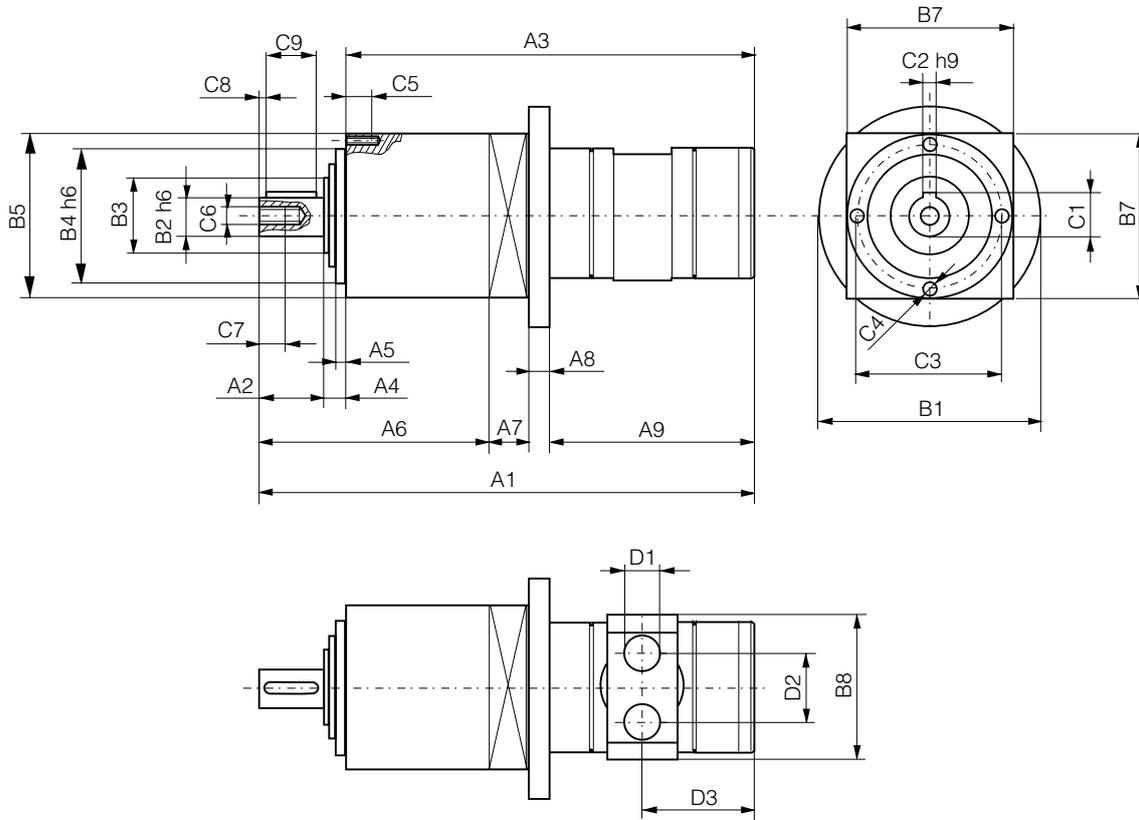


Order code	A1	A2	A3	A4	A5	A6	A7	A8	A9	B1	B2	B3	B4	B5	B6
P1V-A160B0120	274,5	36	228,5	10	5	126,0	22	10	116,5	160	22	40	68	90	80
P1V-A160B0060	274,5	36	228,5	10	5	126,0	22	10	116,5	160	22	40	68	90	80
P1V-A160B0019	359,0	58	289,0	12	5	204,5	28	10	116,5	160	32	50	90	120	80
P1V-A260B0120	317,0	36	271,0	10	6	126,0	32	11	148,0	200	22	40	68	90	100
P1V-A260B0060	317,0	36	271,0	10	6	126,0	32	11	148,0	200	22	40	68	90	100
P1V-A260B0019	391,5	58	321,5	12	6	204,5	28	11	148,0	200	32	50	90	120	100
P1V-A360B0096	375,0	58	305,0	12	6	172,0	38	11	154,0	200	32	50	90	120	135
P1V-A360B0048	375,0	58	305,0	12	6	172,0	38	11	154,0	200	32	50	90	120	135

Order code	B7	B8	C1	C2	C3	C4	C5	C6	C7	C8	C9	D1	D2	D3
P1V-A160B0120	120	85	24,5	6	80	M6	12	M8	13	2	32	G1/2	44	64
P1V-A160B0060	120	85	24,5	6	80	M6	12	M8	13	2	32	G1/2	44	64
P1V-A160B0019	120	85	35,0	10	108	M8	16	M12	22	4	50	G1/2	44	64
P1V-A260B0120	140	102	24,5	6	80	M6	12	M8	13	2	32	G3/4	58	81
P1V-A260B0060	140	102	24,5	6	80	M6	12	M8	13	2	32	G3/4	58	81
P1V-A260B0019	140	102	35,0	10	108	M8	16	M12	22	4	50	G3/4	58	81
P1V-A360B0096	140	138	35,0	10	108	M8	16	M12	22	4	50	G1	70	85
P1V-A360B0048	140	138	35,0	10	108	M8	16	M12	22	4	50	G1	70	85

Choice of an air motor with helical gear

Nominal torque (Nm)

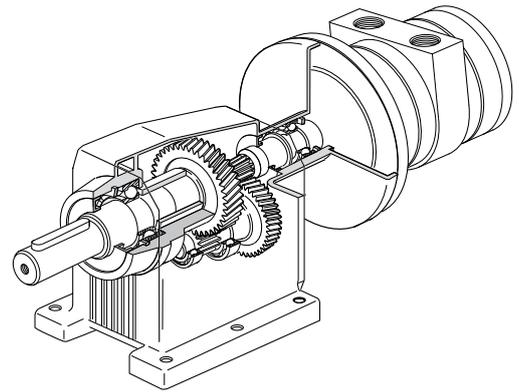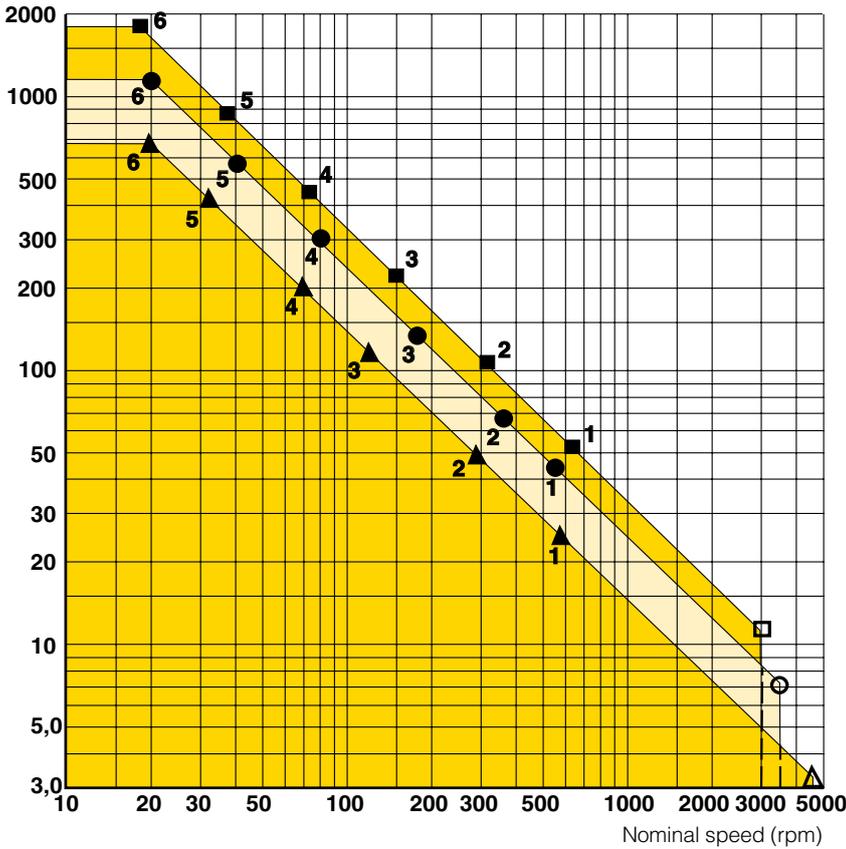

Helical gears are characterised by high efficiency. Several reduction stages permit relatively high gear ratios. Central output shaft and simple installation with flange or foot.

Oil-bath gearboxes mean that the installation position must be decided in advance. The installation position determines the volume of oil in the gearbox and location of oil filling and drain plugs.


- High efficiency
- Simple flange or foot installation
- Relatively low price

- Installation position must be chosen in advance
- Higher weight than planetary or worm drive gears.


Air motors in diagram above

- △ P1V-A160A0900
- ▲ 1 P1V-A160•0066••, Choose installation below
- ▲ 2 P1V-A160•0032••, Choose installation below
- ▲ 3 P1V-A160•0014••, Choose installation below
- ▲ 4 P1V-A160•0008••, Choose installation below
- ▲ 5 P1V-A160•0004••, Choose installation below
- ▲ 6 P1V-A160•0003••, Choose installation below
- P1V-A260A0700
- 1 P1V-A260•0080••, Choose installation below
- 2 P1V-A260•0052••, Choose installation below
- 3 P1V-A260•0025••, Choose installation below
- 4 P1V-A260•0011••, Choose installation below
- 5 P1V-A260•0006••, Choose installation below
- 6 P1V-A260•0003••, Choose installation below
- P1V-A360A0600
- 1 P1V-A360•0105••, Choose installation below
- 2 P1V-A360•0052••, Choose installation below
- 3 P1V-A360•0025••, Choose installation below
- 4 P1V-A360•0013••, Choose installation below
- 5 P1V-A360•0006••, Choose installation below
- 6 P1V-A360•0003••, Choose installation below


Installation, flange mounting

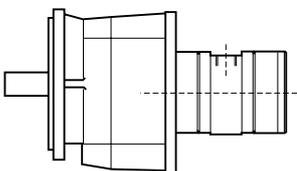

Installation, foot mounting

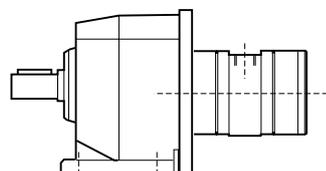

NOTE! All technical data are based on a working pressure of 6 bar and with oil.
Speed tolerance accuracy is +10%.

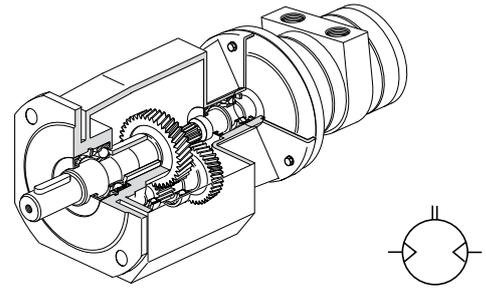

D: Reversible motor with helical gear, flange mounting

Max power kW	Max speed* rpm	Nominal speed rpm	Nominal torque Nm	Min start torque Nm	Max permanent torque** Nm	Air consumption at max power l/s	Connection	Min pipe ID inlet/outlet mm	Weight Kg	Order code
Series P1V-A160										
1,600	660	590	24	36	45	32	G1/2	15	9,8	P1V-A160D0066●●
1,600	320	280	50	75	140	32	G1/2	15	11,5	P1V-A160D0032●●
1,600	140	120	113	171	280	32	G1/2	15	14,4	P1V-A160D0014●●
1,600	80	70	197	299	560	32	G1/2	15	31,7	P1V-A160D0008●●
1,600	37	33	413	626	1000	32	G1/2	15	49,2	P1V-A160D0004●●
1,600	21	18	716	1084	1600	32	G1/2	15	67,2	P1V-A160D0003●●
Series P1V-A260										
2,600	800	565	42	64	42	60	G3/4	19	14,9	P1V-A260D0080●●
2,600	520	365	65	115	125	60	G3/4	19	16,1	P1V-A260D0052●●
2,600	250	175	135	235	200	60	G3/4	19	19,0	P1V-A260D0025●●
2,600	110	80	302	500	430	60	G3/4	19	36,4	P1V-A260D0011●●
2,600	55	40	614	1000	750	60	G3/4	19	54,9	P1V-A260D0006●●
2,600	30	20	990	1600	1200	60	G3/4	19	68,9	P1V-A260D0003●●
Series P1V-A360										
3,600	1050	625	52	78	80	97	G1	25	24,6	P1V-A360D0105●●
3,600	520	310	105	155	175	97	G1	25	24,6	P1V-A360D0052●●
3,600	250	150	216	320	385	97	G1	25	45,0	P1V-A360D0025●●
3,600	125	74	441	652	795	97	G1	25	63,5	P1V-A360D0013●●
3,600	60	36	888	1312	1600	97	G1	25	77,5	P1V-A360D0006●●
3,600	30	18	1800	2670	4000	97	G1	25	151,5	P1V-A360D0003●●

* maximum admissible speed (idling)

** Max gear box torque for a permanent load

Note!


●● specify installation position in the order code as in the illustrations below.

Example: P1V-A160D0066B5


Note: Oil-bath gearboxes mean that the installation position must be decided in advance. The installation position determines the volume of oil in the gearbox and location of oil filling and drain plugs.

D: Installation positions, helical gears and flange


B5

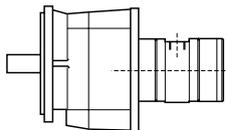

V1

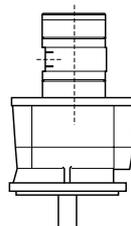


V3

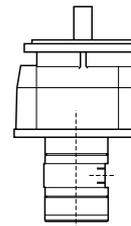

Dimensions (mm)

D: Motor with helical gear, flange mounting

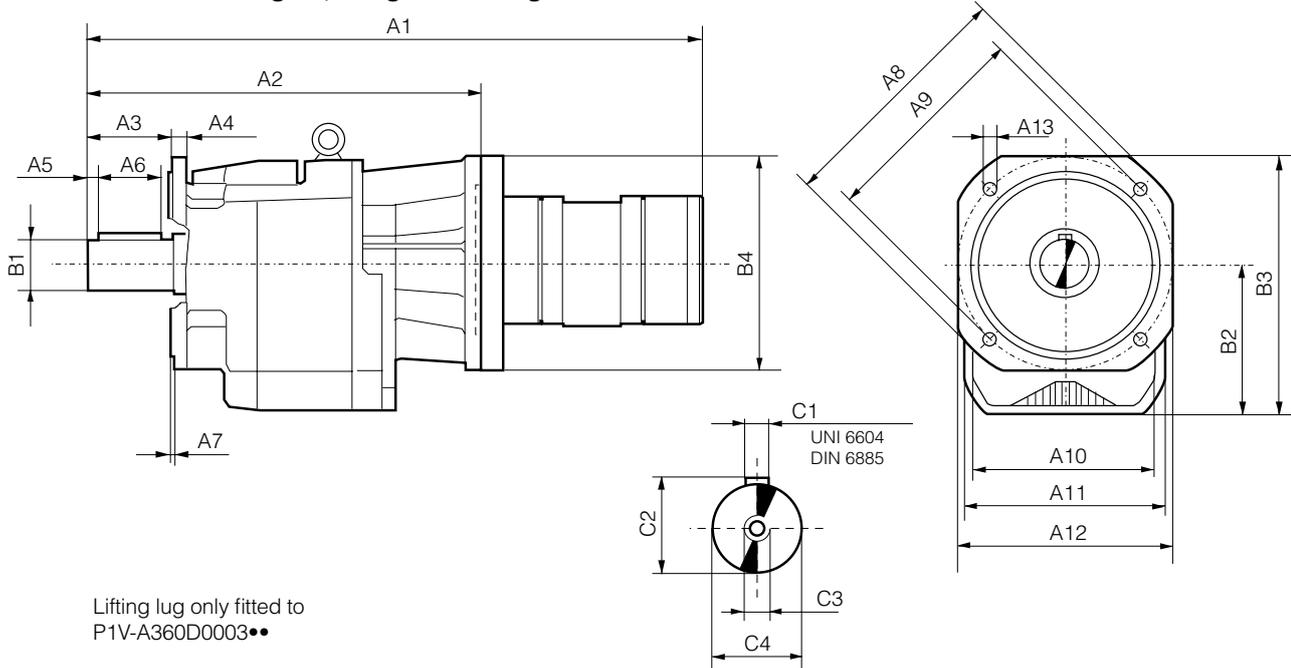


Order code	A1	A2	A3	A4	A5	A6	A7	A8	A9	A10	A11	A12	A13	B1	B2	B3
P1V-A160D0066••	370,5	244	40	8	5	30	3,0	140	115	95f7	95	105	9,5	20	82	138,0
P1V-A160D0032••	399,5	273	50	10	5	40	3,5	160	130	110f7	110	135	9,5	25	92	159,5
P1V-A160D0014••	433,5	307	60	12	5	50	3,5	200	165	130f7	130	150	11,5	30	108	183,0
P1V-A160D0008••	463,5	337	70	13	5	60	4,0	250	215	180 f7	155	210	14,0	35	128	233,0
P1V-A160D0004••	559,5	433	80	16	5	70	5,0	300	265	230 f7	185	260	14,0	40	152	282,0
P1V-A160D0003••	601,5	475	100	16	5	90	5,0	300	265	230 f7	210	260	14,0	50	190	320,0
P1V-A260D0080••	423,0	264	40	8	5	30	3,0	140	115	95f7	95	105	9,5	20	82	138,0
P1V-A260D0052••	451,0	292	50	10	5	40	3,5	160	130	110f7	110	135	9,5	25	92	159,5
P1V-A260D0025••	486,0	327	60	12	5	50	3,5	200	165	130f7	130	150	11,5	30	108	183,0
P1V-A260D0011••	515,0	356	70	13	5	60	4,0	250	215	180 f7	155	210	14,0	35	128	233,0
P1V-A260D0006••	612,0	453	80	16	5	70	5,0	300	265	230 f7	185	260	14,0	40	152	282,0
P1V-A260D0003••	634,0	475	100	16	5	90	5,0	300	265	230 f7	210	260	14,0	50	190	320,0
P1V-A360D0105••	458,0	292	50	10	5	40	3,5	160	130	110f7	110	135	9,5	25	92	159,5
P1V-A360D0052••	458,0	292	50	10	5	40	3,5	160	130	110f7	110	135	9,5	25	92	159,5
P1V-A360D0025••	521,0	356	70	13	5	60	4,0	250	215	180 f7	155	210	14,0	35	128	233,0
P1V-A360D0013••	547,0	382	80	16	5	70	5,0	300	265	230 f7	185	260	14,0	40	152	282,0
P1V-A360D0006••	640,0	475	100	16	5	90	5,0	300	265	230 f7	210	260	14,0	50	190	320,0
P1V-A360D0003••	699,0	534	140	20	15	110	5,0	400	350	300 f7	320	350	18,0	80	247	424,0

Order code	B4	C1	C2	C3	C4
P1V-A160D0066••	160	6x6x30	22,5	M8x19	20 h6
P1V-A160D0032••	160	8x7x40	28,0	M8x19	25 h6
P1V-A160D0014••	160	8x7x50	33,0	M10x22	30 h6
P1V-A160D0008••	160	10x8x60	38,0	M10x22	35 h6
P1V-A160D0004••	160	12x8x70	43,0	M12x28	40 h6
P1V-A160D0003••	160	14x9x90	53,5	M16x36	50 h6
P1V-A260D0080••	200	6x6x30	22,5	M8x19	20 h6
P1V-A260D0052••	200	8x7x40	28,0	M8x19	25 h6
P1V-A260D0025••	200	8x7x50	33,0	M10x22	30 h6
P1V-A260D0011••	200	10x8x60	38,0	M10x22	35 h6
P1V-A260D0006••	200	12x8x70	43,0	M12x28	40 h6
P1V-A260D0003••	200	14x9x90	53,5	M16x36	50 h6
P1V-A360D0105••	200	8x7x40	28,0	M8x19	25 h6
P1V-A360D0052••	200	8x7x40	28,0	M8x19	25 h6
P1V-A360D0025••	200	10x8x60	38,0	M10x22	35 h6
P1V-A360D0013••	200	12x8x70	43,0	M12x28	40 h6
P1V-A360D0006••	200	14x9x90	53,5	M16x36	50 h6
P1V-A360D0003••	200	22x14x110	85,0	M20x42	80 h6

••: see previous page for installation positions

NOTE! All technical data are based on a working pressure of 6 bar and with oil.
Speed tolerance accuracy is $\pm 10\%$.

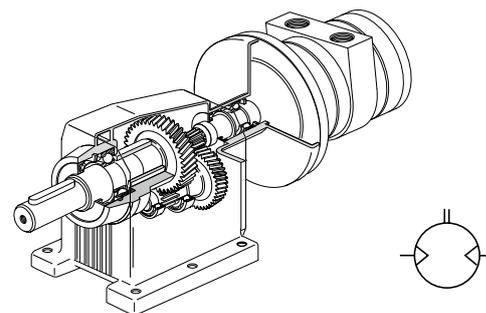

E: Reversible motor with helical gear, foot mounting

Max power kW	Max speed* rpm	Nominal speed rpm	Nominal torque Nm	Min start torque Nm	Max permanent torque** Nm	Air consumption at max power l/s	Connection	Min pipe ID inlet/outlet mm	Weight Kg	Order code
Series P1V-A160										
1,600	660	590	24	36	45	32	G1/2	15	9,8	P1V-A160E0066••
1,600	320	280	50	75	140	32	G1/2	15	11,5	P1V-A160E0032••
1,600	140	120	113	171	280	32	G1/2	15	14,4	P1V-A160E0014••
1,600	80	70	197	299	560	32	G1/2	15	31,7	P1V-A160E0008••
1,600	37	33	415	626	1000	32	G1/2	15	49,2	P1V-A160E0004••
1,600	21	18	716	1084	1600	32	G1/2	15	67,2	P1V-A160E0003••
Series P1V-A260										
2,600	800	565	42	64	42	60	G3/4	19	14,9	P1V-A260E0080••
2,600	520	365	65	100	115	60	G3/4	19	16,1	P1V-A260E0052••
2,600	250	175	135	210	235	60	G3/4	19	19,0	P1V-A260E0025••
2,600	110	80	302	468	500	60	G3/4	19	36,4	P1V-A260E0011••
2,600	55	40	614	951	1000	60	G3/4	19	54,9	P1V-A260E0006••
2,600	30	20	990	1530	1600	60	G3/4	19	68,9	P1V-A260E0003••
Series P1V-A360										
3,600	1050	625	52	78	80	97	G1	25	24,6	P1V-A360E0105••
3,600	520	310	105	158	175	97	G1	25	24,6	P1V-A360E0052••
3,600	250	150	216	323	385	97	G1	25	45,0	P1V-A360E0025••
3,600	125	74	441	660	795	97	G1	25	63,5	P1V-A360E0013••
3,600	62	36	868	1275	1600	97	G1	25	77,5	P1V-A360E0006••
3,600	30	18	1800	2700	4000	97	G1	25	151,5	P1V-A360E0003••

* maximum admissible speed (idling)


** Max gear box torque for a permanent load

Note!
•• specify installation position in the order code as in the illustrations below.
Example: P1V-A160E0066V5


Note: Oil-bath gearboxes mean that the installation position must be decided in advance. The installation position determines the volume of oil in the gearbox and location of oil filling and drain plugs.

E: Installation positions, helical gears and flange


V5

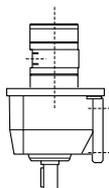

V6

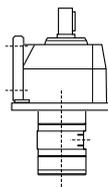


B3

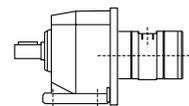


B8



B7

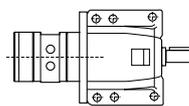


B6

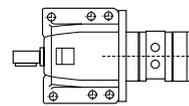

Dimensions (mm)

E: Motor with helical gear, foot mounting

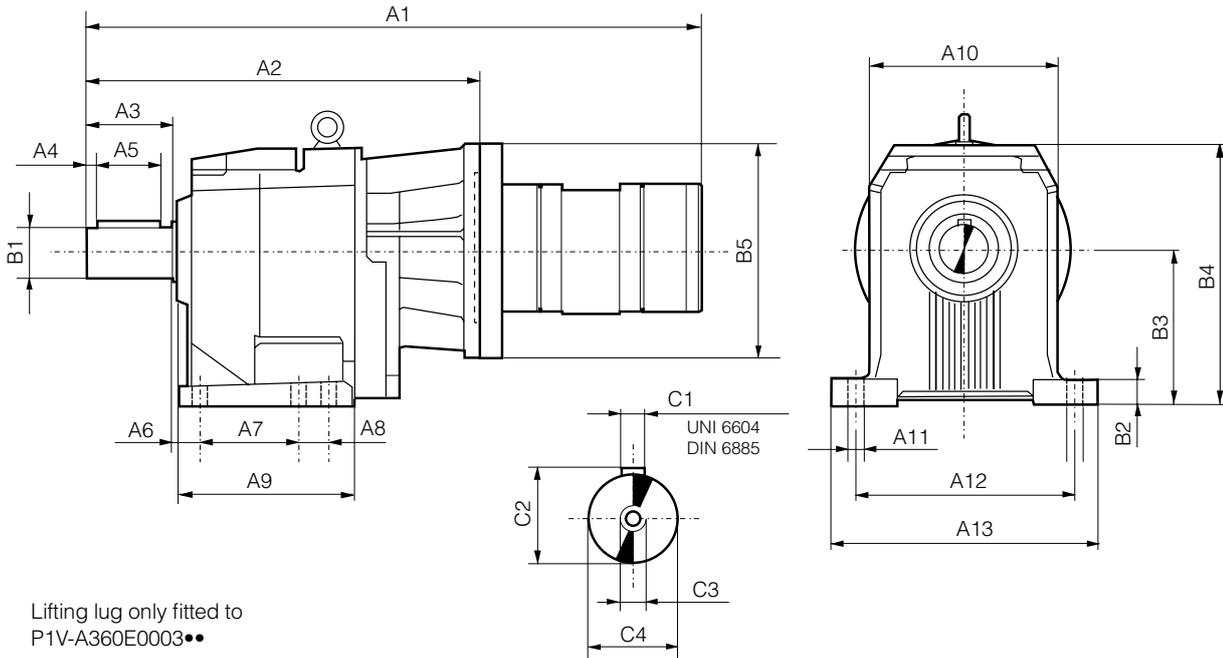


Order code	A1	A2	A3	A4	A5	A6	A7	A8	A9	A10	A11	A12	A13	B1	B2	B3
P1V-A160E0066••	370,5	244	40	5	30	18	50	37,0	107,0	95	9	110	130	20	15	85
P1V-A160E0032••	399,5	273	50	5	40	18	60	47,5	137,0	110	11	130	155	25	17	100
P1V-A160E0014••	433,5	307	60	5	50	18	70	60,0	156,0	130	11	160	190	30	20	110
P1V-A160E0008••	463,5	337	70	5	60	20	105	44,5	185,5	155	14	180	216	35	18	130
P1V-A160E0004••	559,5	433	80	5	70	25	110	46,0	200,0	185	18	225	270	40	22	155
P1V-A160E0003••	601,5	475	100	5	90	25	145	35,0	222,0	210	18	250	300	50	25	195
P1V-A260E0080••	413,0	244	40	5	30	18	50	37,0	107,0	95	9	110	130	20	15	85
P1V-A260E0052••	451,0	292	50	5	40	18	60	47,5	137,0	110	11	130	155	25	17	100
P1V-A260E0025••	486,0	327	60	5	50	18	70	60,0	156,0	130	11	160	190	30	20	110
P1V-A260E0011••	515,0	356	70	5	60	20	105	44,5	185,5	155	14	180	216	35	18	130
P1V-A260E0006••	612,0	453	80	5	70	25	110	46,0	200,0	185	18	225	270	40	22	155
P1V-A260E0003••	654,0	495	100	5	90	25	145	35,0	222,0	210	18	250	300	50	25	195
P1V-A360E0105••	457,0	292	50	5	40	18	60	47,5	137,0	110	11	130	155	25	17	100
P1V-A360E0052••	457,0	292	50	5	40	18	60	47,5	137,0	110	11	130	155	25	17	100
P1V-A360E0025••	521,0	356	70	5	60	20	105	44,5	185,5	155	14	180	216	35	18	130
P1V-A360E0013••	547,0	382	80	5	70	25	110	46,0	200,0	185	18	225	270	40	22	155
P1V-A360E0006••	660,0	495	100	5	90	25	145	35,0	222,0	210	18	250	300	50	25	195
P1V-A360E0003••	699,0	534	140	15	110	33	210	—	277,0	320	26	370	440	80	35	250


Order code	B4	B5	C1	C2	C3	C4
P1V-A160E0066••	141	160	6x6x30	22,5	M8x19	20 h6
P1V-A160E0032••	166	160	8x7x40	28,0	M8x19	25 h6
P1V-A160E0014••	181	160	8x7x50	33,0	M10x22	30 h6
P1V-A160E0008••	223	160	10x8x60	38,0	M10x22	35 h6
P1V-A160E0004••	278	160	12x8x70	43,0	M12x28	40 h6
P1V-A160E0003••	316	160	14x9x90	53,5	M16x36	50 h6
P1V-A260E0080••	141	200	6x6x30	22,5	M8x19	20 h6
P1V-A260E0052••	166	200	8x7x40	28,0	M8x19	25 h6
P1V-A260E0025••	181	200	8x7x50	33,0	M10x22	30 h6
P1V-A260E0011••	223	200	10x8x60	38,0	M10x22	35 h6
P1V-A260E0006••	278	200	12x8x70	43,0	M12x28	40 h6
P1V-A260E0003••	316	200	14x9x90	53,5	M16x36	50 h6
P1V-A360E0105••	166	200	8x7x40	28,0	M8x19	25 h6
P1V-A360E0052••	166	200	8x7x40	28,0	M8x19	25 h6
P1V-A360E0025••	223	200	10x8x60	38,0	M10x22	35 h6
P1V-A360E0013••	278	200	12x8x70	43,0	M12x28	40 h6
P1V-A360E0006••	316	200	14x9x90	53,5	M16x36	50 h6
P1V-A360E0003••	420	200	22x14x110	85,0	M20x42	80 h6

••: see previous page for installation positions


P1V-A160D0066••
P1V-A160E0066••

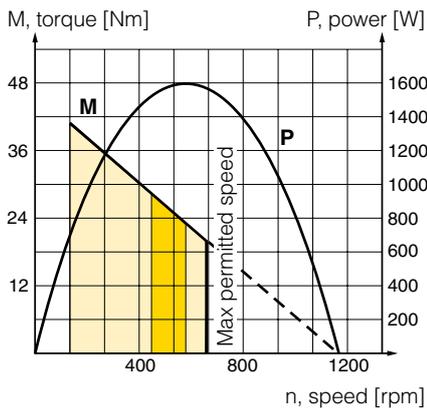


P1V-A160D0032••
P1V-A160E0032••

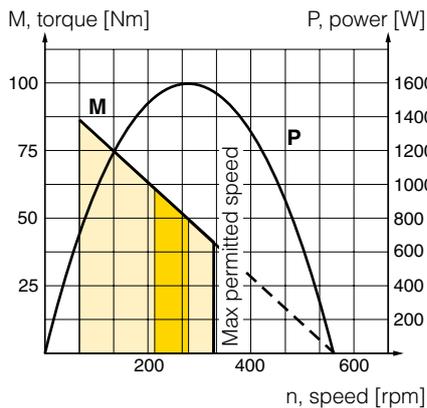


P1V-A160D0014••
P1V-A160E0014••

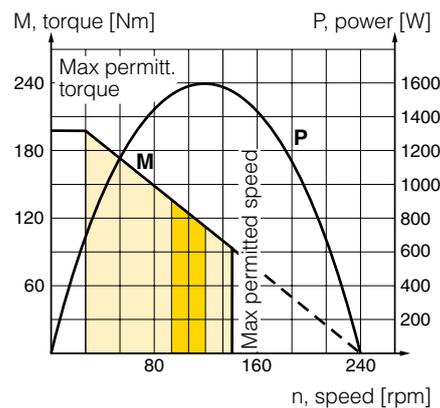


P1V-A160D0008••
P1V-A160E0008••

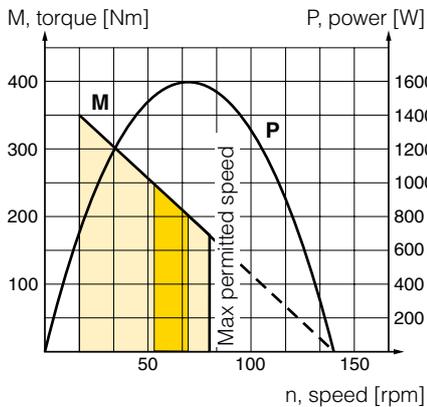


P1V-A160D0004••
P1V-A160E0004••

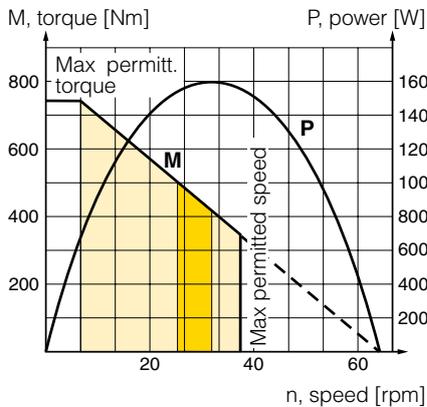


P1V-A160D0003••
P1V-A160E0003••

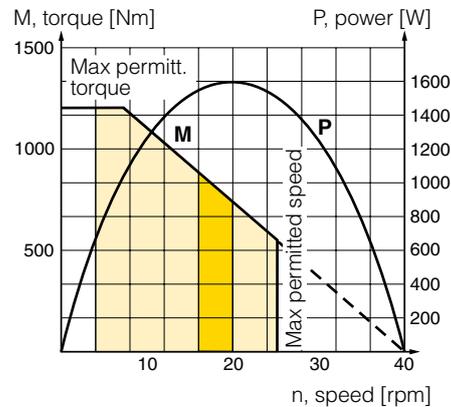


P1V-A260D0080••
P1V-A260E0080••

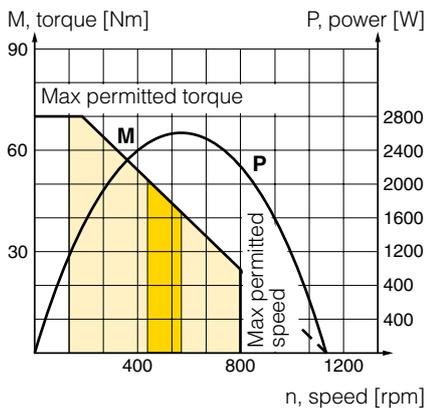

P1V-A260D0052••
P1V-A260E0052••

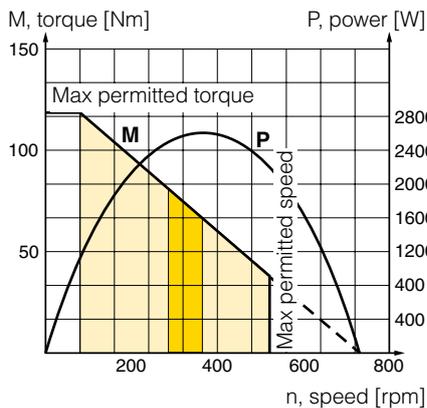

P1V-A260D0025••
P1V-A260E0025••

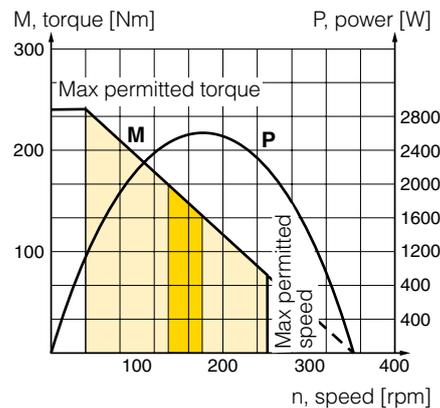


Possible working range of motor.


Optimum working range of motor.

Higher speeds = more vane wear
Lower speeds with high torque = more gearbox wear


P1V-A260D0011••
P1V-A260E0011••

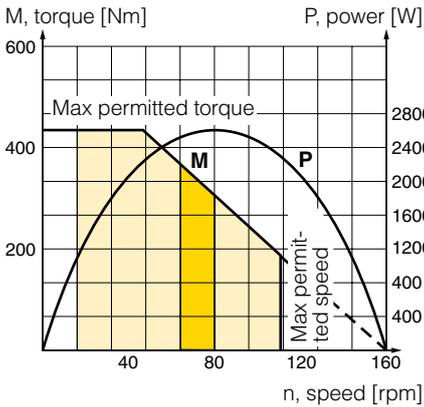


P1V-A260D0006••
P1V-A260E0006••

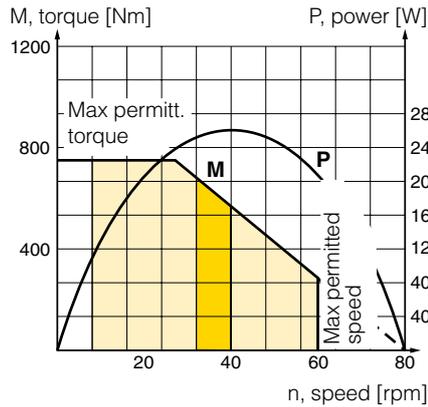


P1V-A260D0003••
P1V-A260E0003••

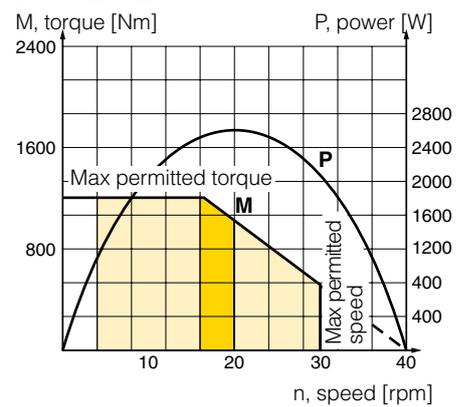


P1V-A360D0105••
P1V-A360E0105••

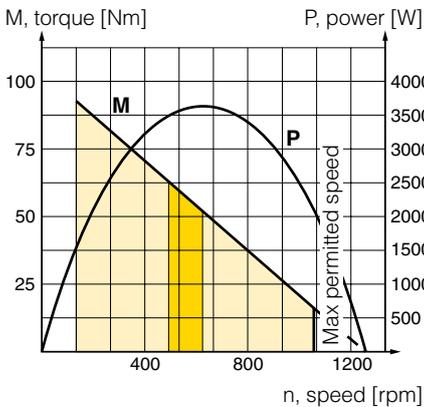


P1V-A360D0052••
P1V-A360E0052••

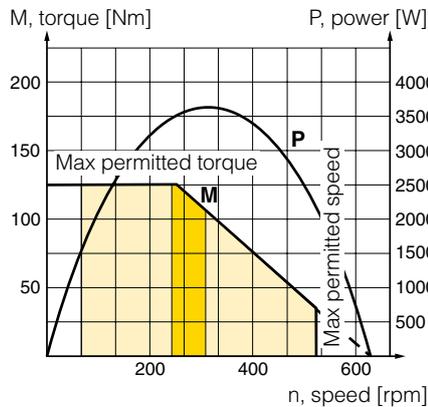


P1V-A360D0025••
P1V-A360E0025••

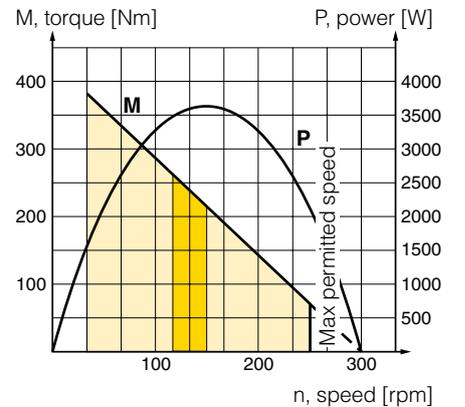


P1V-A360D0013••
P1V-A360E0013••

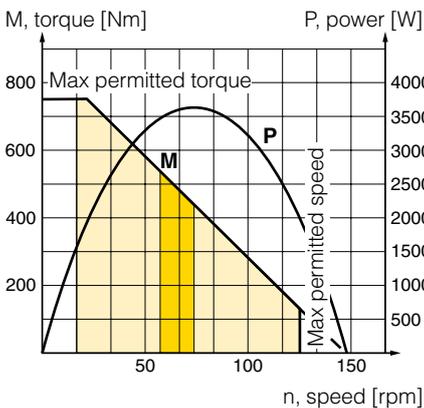

P1V-A360D0006••
P1V-A360E0006••

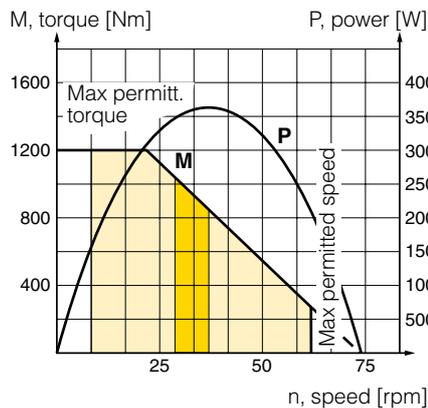

P1V-A360D0003••
P1V-A360E0003••

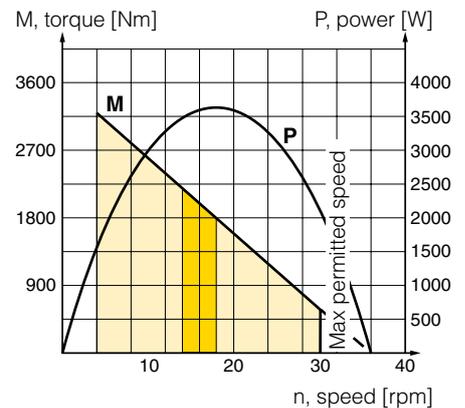

 Possible working range of motor.

 Optimum working range of motor.

Higher speeds = more vane wear
Lower speeds with high torque = more gearbox wear

Permitted shaft loadings

Radial forces

Depending on the application, the drive shaft of the gearbox can be subjected to various radial forces, which can be calculated as follows:

$$F_{rad} = 2000 \times M \times K_r / d$$

- F_{rad} Radial force (N)
- M Torque (Nm)
- d Diameter of wheel, pulley, sprocket or gear wheel (mm)
- $K_r = 1$ Sprocket constant
- $K_r = 1.25$ Gear wheel constant
- $K_r = 1.5 - 2.5$ Vee-belt pulley constant

Depending on the point of application of the force (please refer to the adjacent figure), the following two cases are found:

- a. The force is applied to the centre of the output shaft, as in figure 3. This value can be read off on the table below, where consideration must be given to the following:

$$F_{radc} \leq F_{rt}$$

- b. The force is applied at a distance x, as in figure 4. This value can be calculated as follows:

$$F_{radx} = F_{rt} \times a / (b + X) \quad L/2 < X < c$$

- F_{rt} Permissible radial force on centre of output-shaft (N)
- a Gear constant
- b Gear constant
- c Gear constant
- X Distance from shoulder on shaft to point of application of force (mm)

All values are found in the table below.
 The following should be considered, however:

$$F_{radc} \leq F_{radx}$$

Motor	a	b	c	F_{rt} N
P1V-A160•0066••	46,0	26,0	450	1130
P1V-A160•0032••	54,5	29,5	550	2480
P1V-A160•0014••	60,5	30,5	750	4710
P1V-A160•0008••	69,0	34,0	850	6620
P1V-A160•0004••	80,5	40,5	900	10000
P1V-A160•0003••	98,5	48,5	1000	16000
P1V-A260•0080••	46,0	26,0	450	660
P1V-A260•0052••	54,5	29,5	550	2110
P1V-A260•0025••	60,5	30,5	750	3850
P1V-A260•0011••	69,0	34,0	850	5660
P1V-A260•0006••	80,5	40,5	900	10000
P1V-A260•0003••	98,5	48,5	1000	16000
P1V-A360•0105••	54,5	29,5	550	1640
P1V-A360•0052••	54,5	29,5	550	2110
P1V-A360•0025••	69,0	34,0	850	4280
P1V-A360•0013••	80,5	40,5	900	6890
P1V-A360•0006••	98,5	48,5	1000	16000
P1V-A360•0003••	131,0	61,0	1500	35000

- Motor with helical gear (functions D and E)
- Installation position, optional

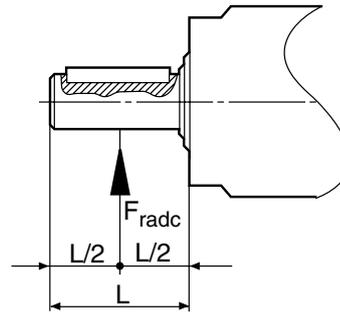


Fig. 3: Force applied at centre of shaft

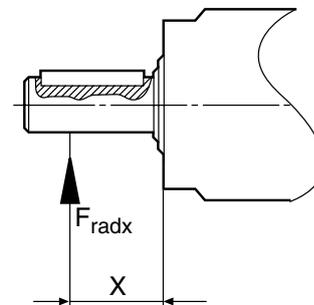


Fig. 4: Force applied at distance X



Axial forces

The maximum permissible axial force can be calculated as follows:

$$F_{ax} = F_{rt} \times 0,2$$

Choice of an air motor with worm gear

Nominal torque (Nm)

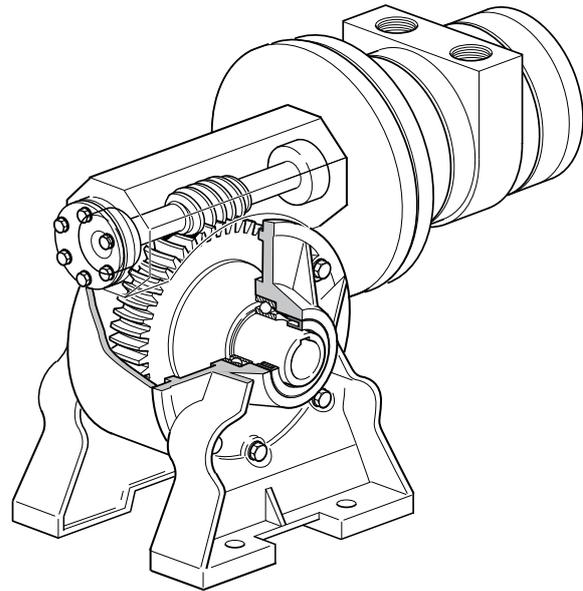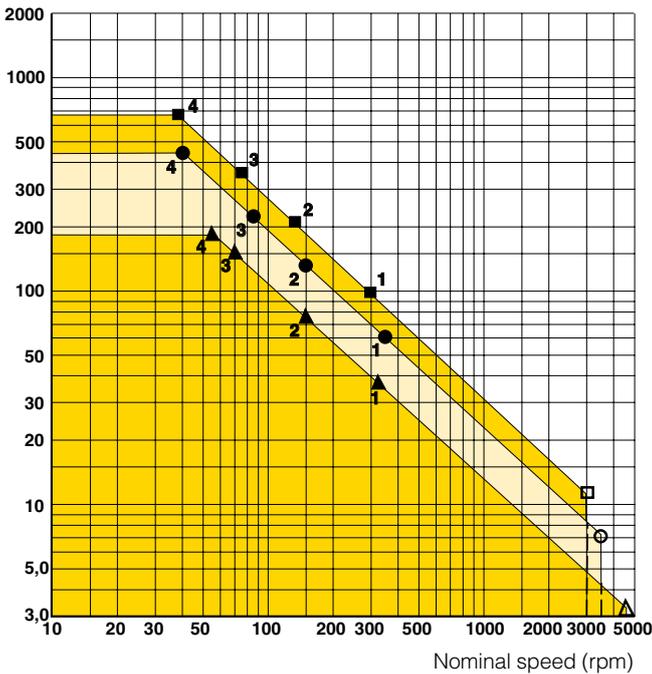

Worm gears are characterised by relatively simple technical construction, with a worm and pinion. This can give a large gear ratio and small dimensions. The efficiency of a worm drive gear is considerably lower than for planetary or helical gears. The design principle of worm drive gears makes them self-locking at higher gear ratios (the output shaft is "locked").

The output shaft comes out at an angle of 90° to the motor spindle. Installation is simple, with a flange on the left or right side, or with a foot. The gearbox is equipped as standard with a hollow output shaft with a key slot. Loose shafts with key can put the output shaft on the right, left, or on both sides.


Oil-bath gearboxes mean that the installation position must be decided in advance. The installation position determines the volume of oil in the gearbox and location of oil filling and drain plugs.

- Low weight in relation to gear ratio
- Non-reversible at high gear ratios
- Relatively low price
- Relatively low efficiency
- Installation position must be decided in advance
- Output shaft at 90° to motor spindle


Air motors in diagram above

- △ P1V-A160A0900
- ▲ 1 P1V-A160•0043••, Choose installation below
- ▲ 2 P1V-A160•0020••, Choose installation below
- ▲ 3 P1V-A160•0010••, Choose installation below
- ▲ 4 P1V-A160•0008••, Choose installation below
- P1V-A260A0700
- 1 P1V-A260•0050••, Choose installation below
- 2 P1V-A260•0022••, Choose installation below
- 3 P1V-A260•0013••, Choose installation below
- 4 P1V-A260•0008••, Choose installation below
- P1V-A360A0600
- 1 P1V-A360•0050••, Choose installation below
- 2 P1V-A360•0022••, Choose installation below
- 3 P1V-A360•0013••, Choose installation below
- 4 P1V-A360•0006••, Choose installation below


Installation, foot mounting

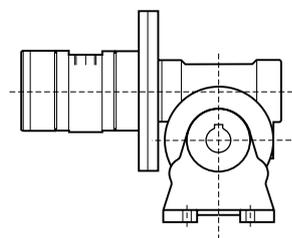


Installation, flange mounting, left-hand

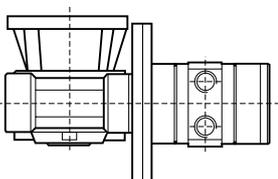

Installation, flange mounting, right-hand

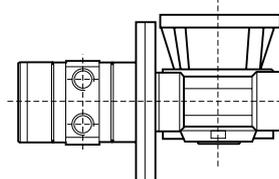

NOTE! All technical data are based on a working pressure of 6 bar and with oil.
 Speed tolerance accuracy is $\pm 10\%$.

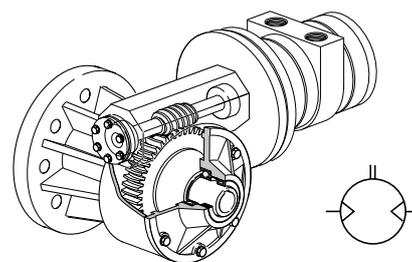

F: Reversible motor with worm gear, flange mounting left-hand

Max power kW	Max speed* rpm	Nominal speed rpm	Nominal torque Nm	Min start torque Nm	Max permanent torque** Nm	Types of self-locking	Air consumption at max power l/s	Connection	Min pipe ID inlet/outlet mm	Weight Kg	Order code
Series P1V-A160											
1,600	430	320	38	40	44	1	32	G1/2	15	7,2	P1V-A160F0043••
1,600	200	150	77	65	125	2	32	G1/2	15	10,5	P1V-A160F0020••
1,600	95	70	154	117	250	3	32	G1/2	15	17,8	P1V-A160F0010••
1,600	75	55	180	130	225	3	32	G1/2	15	17,8	P1V-A160F0008••
Series P1V-A260											
2,600	500	350	62	71	88	1	60	G3/4	19	14,5	P1V-A260F0050••
2,600	220	150	133	133	430	1	60	G3/4	19	21,0	P1V-A260F0022••
2,600	125	85	224	191	430	2	60	G3/4	19	21,0	P1V-A260F0013••
2,600	62	40	414	621	1500	3	60	G3/4	19	57,0	P1V-A260F0008••
Series P1V-A360											
3,600	500	300	98	113	125	1	97	G1	25	22,9	P1V-A360F0050••
3,600	220	130	224	230	285	1	97	G1	25	31,0	P1V-A360F0022••
3,600	125	75	368	317	595	2	97	G1	25	55,0	P1V-A360F0013••
3,600	62	37	670	1005	1500	3	97	G1	25	65,5	P1V-A360F0006••

* maximum admissible speed (idling)

** Max gear box torque for a permanent load


Note!

•• specify installation position in the order code as in the illustrations below.


Example: P1V-A160F0066B3

F: Installation positions, worm gear and flange, left-hand


B3

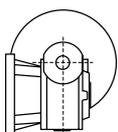


V6

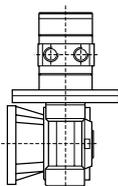


V5

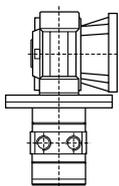


B8

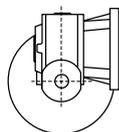

B6

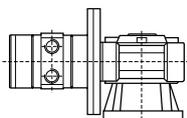

B7

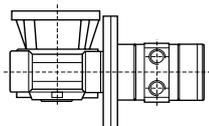

Note: Oil-bath gearboxes mean that the installation position must be decided in advance. The installation position determines the volume of oil in the gearbox and location of oil filling and drain plugs.

Self-locking

Dynamic self-locking means that the force acting on the output shaft of the gear can not turn the gear further when the air motor is stopped. Dynamic self-locking is only possible when the gear ratio is high, and at low speeds. None of our worm drive gears are completely self-locking in dynamic conditions.

Static self-locking means that the force acting on the output shaft of the gear can not begin to turn the shaft.

When loads with considerable momentum are driven, it is necessary to have a braking time sufficient to stop the gearbox from being overloaded. It is extremely important that the maximum permitted torque is not exceeded.

Tip: Braking of the air motor can be arranged by either slowly restricting the air supply to the motor until it is completely shut off, or by slowly reducing the supply pressure to zero.

Types of Self-locking

1. Static, not self-locking
2. Static, self-locking - quicker return under vibration - not dynamically self-locking
3. Static, self-locking - return only possible under vibration - good dynamic self-locking




Important!

Since it is practically impossible to guarantee total self-locking, an external brake must be used to guarantee that vibration can not cause an output shaft to move.

Dimensions (mm)

F: Motor with worm gear, flange mounting

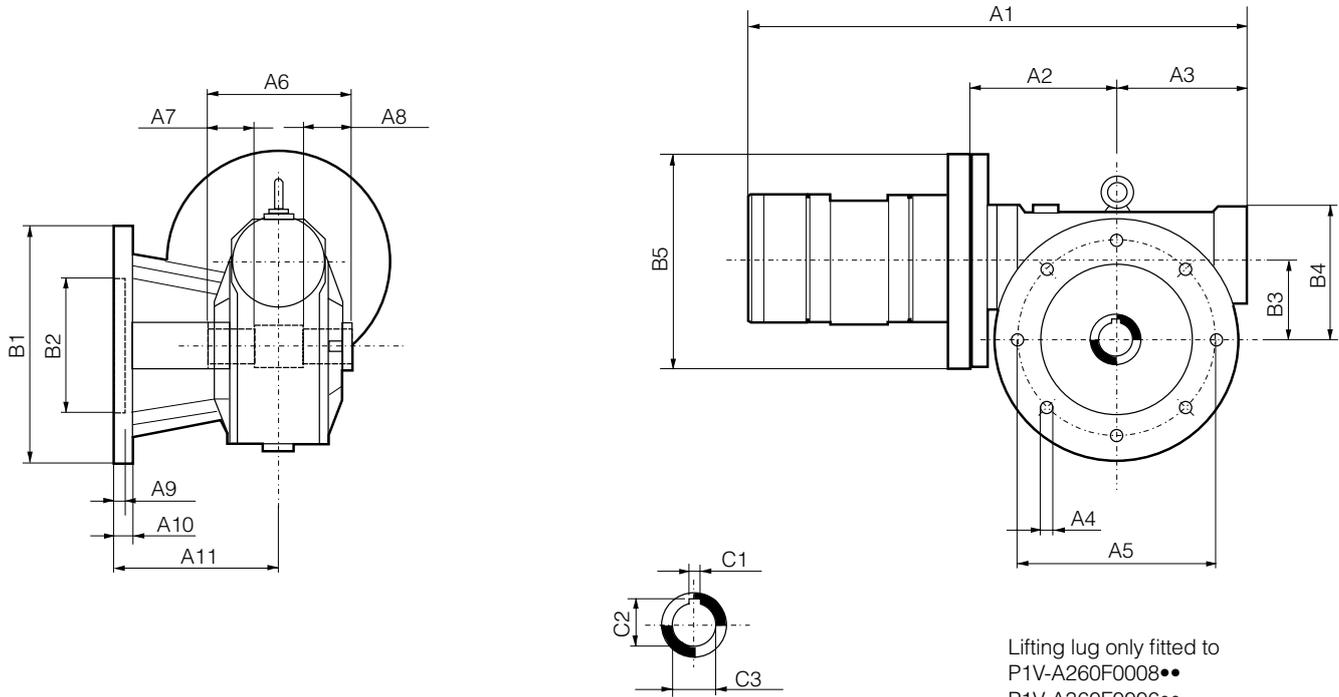

Lifting lug only fitted to
 P1V-A260F0008••
 P1V-A360F0006••


As standard, the motor has a hollow shaft with key slot. Please refer to next page for a dimension sketch of the single ended and double ended shafts.

Order code	A1	A2	A3	A4	A5	A6	A7	A8	A9	A10	A11	B1	B2	B3
P1V-A160F0043••	259,5	70	63	10,5	90	82	22,5	22,5	10	12	85,0	125	70 H8	49,50
P1V-A160F0020••	301,5	95	80	10,5	130	120	40,0	40,0	8	11	116,0	180	115 H8	62,17
P1V-A160F0010••	362,5	126	110	12,5	176	140	45,0	45,0	15	15	151,0	210	152 H8	86,90
P1V-A160F0008••	362,5	126	110	12,5	176	140	45,0	45,0	15	15	151,0	210	152 H8	86,90
P1V-A260F0050••	292,0	70	63	10,5	90	82	22,5	22,5	10	12	85,0	125	70 H8	49,50
P1V-A260F0022••	395,0	126	110	12,5	176	140	45,0	45,0	15	15	151,0	210	152 H8	86,90
P1V-A260F0013••	395,0	126	110	12,5	176	140	45,0	45,0	15	15	151,0	210	152 H8	86,90
P1V-A260F0008••	498,0	185	154	16,0	255	165	52,5	52,5	18	20	197,5	320	180 H8	130,00
P1V-A360F0050••	340,0	95	80	10,5	130	120	40,0	40,0	8	11	116,0	180	115 H8	62,17
P1V-A360F0022••	401,0	126	110	12,5	176	140	45,0	45,0	15	15	151,0	210	152 H8	86,90
P1V-A360F0013••	456,0	153	138	13,5	230	155	45,0	45,0	18	20	179,5	280	170 H8	110,10
P1V-A360F0006••	504,0	185	154	16,0	255	165	52,5	52,5	18	20	197,5	320	180 H8	130,00

Order code	B4	B5	C1	C2	C3
P1V-A160F0043••	80,0	160	8 H8	28,3	25 H7
P1V-A160F0020••	98,5	160	8 H8	28,3	25 H7
P1V-A160F0010••	138,0	160	10 H8	38,3	35 H7
P1V-A160F0008••	138,0	160	10 H8	38,3	35 H7
P1V-A260F0050••	80,0	200	8 H8	28,3	25 H7
P1V-A260F0022••	138,0	200	10 H8	38,3	35 H7
P1V-A260F0013••	138,0	200	10 H8	38,3	35 H7
P1V-A260F0008••	195,0	200	14 H8	48,8	45 H7
P1V-A360F0050••	98,5	200	8 H8	28,3	25 H7
P1V-A360F0022••	138,0	200	10 H8	38,3	35 H7
P1V-A360F0013••	169,0	200	12 H8	45,3	42 H7
P1V-A360F0006••	195,0	200	14 H8	48,8	45 H7

••: see previous page for installation positions

NOTE! All technical data are based on a working pressure of 6 bar and with oil.
 Speed tolerance accuracy is $\pm 10\%$.

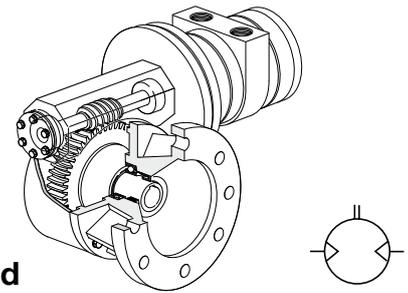

G: Reversible motor with worm gear, flange mounting, right-hand

Max power	Max speed*	Nominal speed	Nominal torque	Min start torque	Max permanent torque**	Types of self-locking	Air consumption at max power	Connection	Min pipe ID inlet/outlet	Weight	Order code
kW	rpm	rpm	Nm	Nm	Nm		l/s		mm	Kg	
Series P1V-A160											
1,600	430	320	38	40	44	1	32	G1/2	15	7,2	P1V-A160G0043••
1,600	200	150	77	65	125	2	32	G1/2	15	10,5	P1V-A160G0020••
1,600	95	70	154	117	250	3	32	G1/2	15	17,8	P1V-A160G0010••
1,600	75	55	180	130	255	3	32	G1/2	15	17,8	P1V-A160G0008••
Series P1V-A260											
2,600	500	350	62	71	88	1	60	G3/4	19	14,5	P1V-A260G0050••
2,600	220	150	133	133	130	1	60	G3/4	19	21,0	P1V-A260G0022••
2,600	125	85	224	191	430	2	60	G3/4	19	21,0	P1V-A260G0013••
2,600	62	40	414	621	1500	3	60	G3/4	19	57,0	P1V-A260G0008••
Series P1V-A360											
3,600	500	300	98	113	125	1	97	G1	25	22,9	P1V-A360G0050••
3,600	220	130	224	230	285	1	97	G1	25	31,0	P1V-A360G0022••
3,600	125	75	368	317	595	2	97	G1	25	55,0	P1V-A360G0013••
3,600	62	37	670	1005	1500	3	97	G1	25	65,5	P1V-A360G0006••

* maximum admissible speed (idling)


** Max gear box torque for a permanent load

Note!

•• specify installation position in the order code as in the illustrations below.

Example: P1V-A160G0066B3

G: Installation positions, worm gear and flange, right-hand

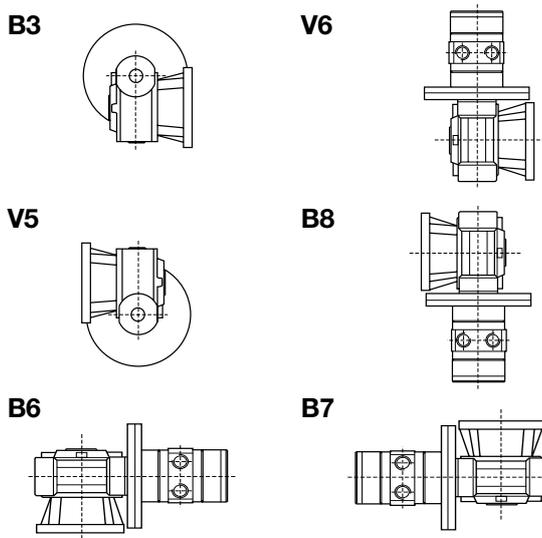

Note: Oil-bath gearboxes mean that the installation position must be decided in advance. The installation position determines the volume of oil in the gearbox and location of oil filling and drain plugs.

Self-locking

Dynamic self-locking means that the force acting on the output shaft of the gear can not turn the gear further when the air motor is stopped. Dynamic self-locking is only possible when the gear ratio is high, and at low speeds. None of our worm drive gears are completely self-locking in dynamic conditions.

Static self-locking means that the force acting on the output shaft of the gear can not begin to turn the shaft.

When loads with considerable momentum are driven, it is necessary to have a braking time sufficient to stop the gearbox from being overloaded. It is extremely important that the maximum permitted torque is not exceeded.

Tip: Braking of the air motor can be arranged by either slowly restricting the air supply to the motor until it is completely shut off, or by slowly reducing the supply pressure to zero.

Types of Self-locking

1. Static, not self-locking
2. Static, self-locking - quicker return under vibration - not dynamically self-locking
3. Static, self-locking - return only possible under vibration - good dynamic self-locking




Important!

Since it is practically impossible to guarantee total self-locking, an external brake must be used to guarantee that vibration can not cause an output shaft to move.

Dimensions (mm)

G: Motor with worm gear, flange mounting

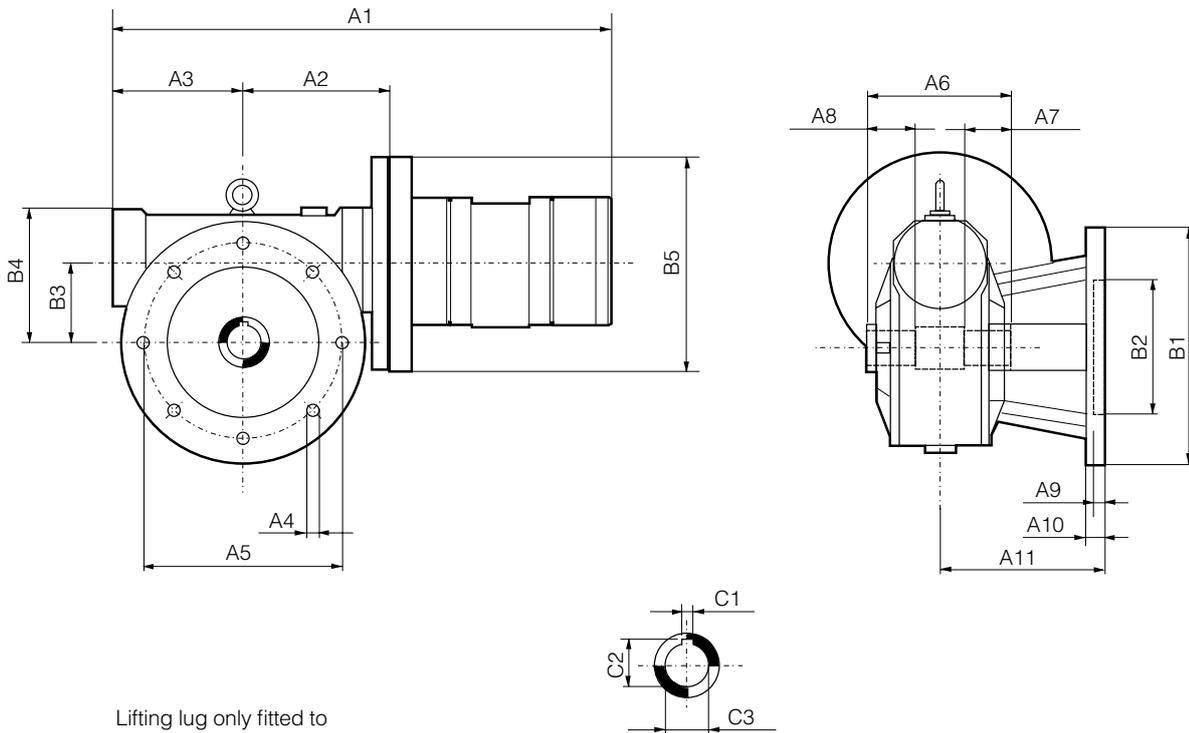

Lifting lug only fitted to
P1V-A260G0008••
P1V-A360G0006••


As standard, the motor has a hollow shaft with key slot. Please refer to page 36 for a dimension sketch of the single ended and double ended shafts.

Order code	A1	A2	A3	A4	A5	A6	A7	A8	A9	A10	A11	B1	B2	B3
P1V-A160G0043••	259,5	70	63	10,5	90	82	22,5	22,5	10	12	85,0	125	70 H8	49,50
P1V-A160G0020••	301,5	95	80	10,5	130	120	40,0	40,0	8	11	116,0	180	115 H8	62,17
P1V-A160G0010••	362,5	126	110	12,5	176	140	45,0	45,0	15	15	151,0	210	152 H8	86,90
P1V-A160G0008••	362,5	126	110	12,5	176	140	45,0	45,0	15	15	151,0	210	152 H8	86,90
P1V-A260G0050••	292,0	70	63	10,5	90	82	22,5	22,5	10	12	85,0	125	70 H8	49,50
P1V-A260G0022••	395,0	126	110	12,5	176	140	45,0	45,0	15	15	151,0	210	152 H8	86,90
P1V-A260G0013••	395,0	126	110	12,5	176	140	45,0	45,0	15	15	151,0	210	152 H8	86,90
P1V-A260G0008••	498,0	185	154	16,0	255	165	52,5	52,5	18	20	197,5	320	180 H8	130,00
P1V-A360G0050••	340,0	95	80	10,5	130	120	40,0	40,0	8	11	116,0	180	115 H8	62,17
P1V-A360G0022••	401,0	126	110	12,5	176	140	45,0	45,0	15	15	151,0	210	152 H8	86,90
P1V-A360G0013••	456,0	153	138	13,5	230	155	45,0	45,0	18	20	179,5	280	170 H8	110,10
P1V-A360G0006••	504,0	185	154	16,0	255	165	52,5	52,5	18	20	197,5	320	180 H8	130,00

Order code	B4	B5	C1	C2	C3
P1V-A160G0043••	80,0	160	8 H8	28,3	25 H7
P1V-A160G0020••	98,5	160	8 H8	28,3	25 H7
P1V-A160G0010••	138,0	160	10 H8	38,3	35 H7
P1V-A160G0008••	138,0	160	10 H8	38,3	35 H7
P1V-A260G0050••	80,0	200	8 H8	28,3	25 H7
P1V-A260G0022••	138,0	200	10 H8	38,3	35 H7
P1V-A260G0013••	138,0	200	10 H8	38,3	35 H7
P1V-A260G0008••	195,0	200	14 H8	48,8	45 H7
P1V-A360G0050••	98,5	200	8 H8	28,3	25 H7
P1V-A360G0022••	138,0	200	10 H8	38,3	35 H7
P1V-A360G0013••	169,0	200	12 H8	45,3	42 H7
P1V-A360G0006••	195,0	200	14 H8	48,8	45 H7

••: see previous page for installation positions

NOTE! All technical data are based on a working pressure of 6 bar and with oil.
Speed tolerance accuracy is $\pm 10\%$.

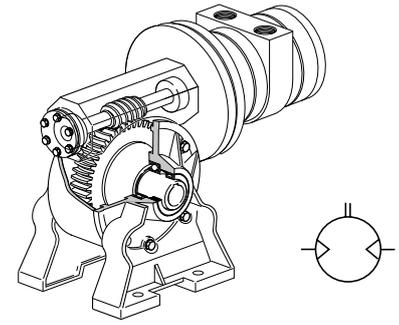


H: Reversible motor with worm gear, foot mounting

Max power kW	Max speed* rpm	Nominal speed rpm	Nominal torque Nm	Min start torque Nm	Max permanent torque** Nm	Types of self-locking	Air consumption at max power l/s	Connection	Min pipe ID inlet/outlet mm	Weight Kg	Order code
Series P1V-A160											
1,600	430	320	38	40	44	1	32	G1/2	15	7,2	P1V-A160H0043••
1,600	200	150	77	114	180	2	32	G1/2	15	10,2	P1V-A160H0020••
1,600	95	70	154	225	430	3	32	G1/2	15	20,5	P1V-A160H0010••
1,600	75	55	180	267	430	3	32	G1/2	15	20,5	P1V-A160H0008••
Series P1V-A260											
2,600	500	350	62	90	88	1	60	G3/4	19	11,0	P1V-A260H0050••
2,600	220	150	133	206	430	1	60	G3/4	19	21,0	P1V-A260H0022••
2,600	125	85	224	330	430	2	60	G3/4	19	21,0	P1V-A260H0013••
2,600	62	40	414	308	660	3	60	G3/4	19	57,0	P1V-A260H0008••
Series P1V-A360											
3,600	500	300	98	150	180	1	97	G1	25	22,5	P1V-A360H0050••
3,600	220	130	224	333	430	1	97	G1	25	33,0	P1V-A360H0022••
3,600	125	75	368	552	800	2	97	G1	25	49,0	P1V-A360H0013••
3,600	62	37	670	480	660	3	97	G1	25	65,5	P1V-A360H0006••

* maximum admissible speed (idling)
** Max gear box torque for a permanent load

Note!
•• specify installation position in the order code as in the illustrations below.
Example: P1V-A160H0066B3

H: Installation positions, worm gear and foot

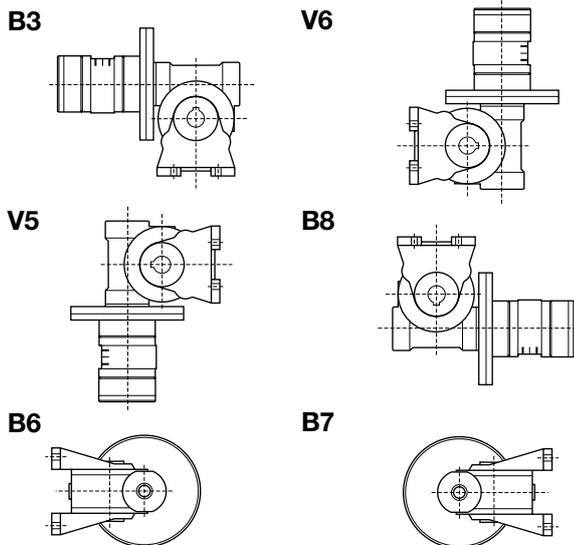

Note: Oil-bath gearboxes mean that the installation position must be decided in advance. The installation position determines the volume of oil in the gearbox and location of oil filling and drain plugs.

Self-locking

Dynamic self-locking means that the force acting on the output shaft of the gear can not turn the gear further when the air motor is stopped. Dynamic self-locking is only possible when the gear ratio is high, and at low speeds. None of our worm drive gears are completely self-locking in dynamic conditions.

Static self-locking means that the force acting on the output shaft of the gear can not begin to turn the shaft.

When loads with considerable momentum are driven, it is necessary to have a braking time sufficient to stop the gearbox from being overloaded. It is extremely important that the maximum permitted torque is not exceeded.

Tip: Braking of the air motor can be arranged by either slowly restricting the air supply to the motor until it is completely shut off, or by slowly reducing the supply pressure to zero.


Types of Self-locking

1. Static, not self-locking
2. Static, self-locking - quicker return under vibration - not dynamically self-locking
3. Static, self-locking - return only possible under vibration - good dynamic self-locking

Important!
Since it is practically impossible to guarantee total self-locking, an external brake must be used to guarantee that vibration can not cause an output shaft to move.

Dimensions (mm)

H: Motor with worm gear, foot mounting

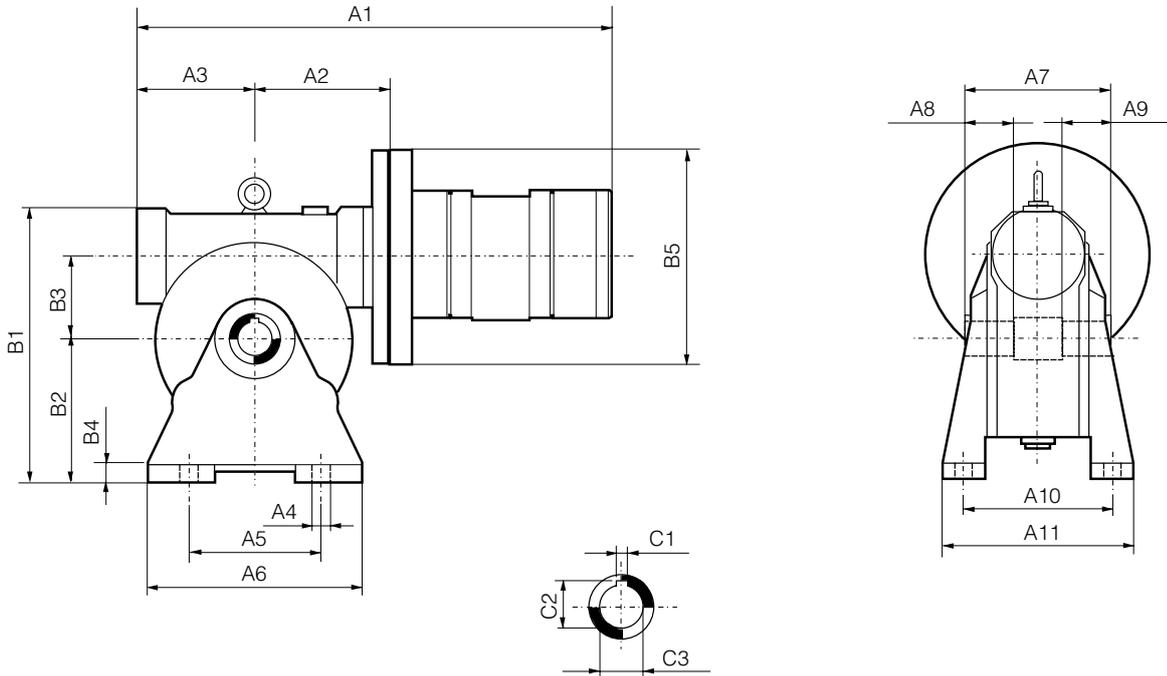

Lifting lug only fitted to
 P1V-A260H0008••
 P1V-A360H0006••

As standard, the motor has a hollow shaft with key slot. Please refer to page 36 for a dimension sketch of the single ended and double ended shafts.

Order code	A1	A2	A3	A4	A5	A6	A7	A8	A9	A10	A11	B1	B2	B3
P1V-A160H0043••	259,5	70	63	8,5	63	110	82	22,5	22,5	98,5	124	162	82	49,50
P1V-A160H0020••	301,5	95	80	10,5	95	140	120	40,0	40,0	111,0	143	199	100	62,17
P1V-A160H0010••	362,5	126	110	11,0	140	220	140	45,0	45,0	146,0	186	280	142	86,90
P1V-A160H0008••	362,5	126	110	11,0	140	220	140	45,0	45,0	146,0	186	280	142	86,90
P1V-A260H0050••	292,0	70	63	8,5	63	110	82	22,5	22,5	98,5	124	162	82	49,50
P1V-A260H0022••	395,0	126	110	11,0	140	220	140	45,0	45,0	146,0	186	280	142	86,90
P1V-A260H0013••	395,0	126	110	11,0	140	220	140	45,0	45,0	146,0	186	280	142	86,90
P1V-A260H0008••	498,0	185	154	16,0	220	310	165	52,5	52,5	191,0	245	398	195	130,00
P1V-A360H0050••	340,0	95	80	10,5	95	140	120	40,0	40,0	111,0	143	199	100	62,17
P1V-A360H0022••	401,0	126	110	11,0	140	220	140	45,0	45,0	146,0	186	280	142	86,90
P1V-A360H0013••	456,0	138	153	12,5	200	270	155	45,0	45,0	181,0	220	339	170	110,10
P1V-A360H0006••	504,0	185	154	16,0	220	310	165	52,5	52,5	191,0	245	398	195	130,00


Order code	B4	B5	C1	C2	C3
P1V-A160H0043••	12	160	8 H8	28,3	25 H7
P1V-A160H0020••	12	160	8 H8	28,3	25 H7
P1V-A160H0010••	14	160	10 H8	38,3	35 H7
P1V-A160H0008••	14	160	10 H8	38,3	35 H7
P1V-A260H0050••	12	200	8 H8	28,3	25 H7
P1V-A260H0022••	14	200	10 H8	38,3	35 H7
P1V-A260H0013••	14	200	10 H8	38,3	35 H7
P1V-A260H0008••	18	200	14 H8	48,8	45 H7
P1V-A360H0050••	12	200	8 H8	28,3	25 H7
P1V-A360H0022••	14	200	10 H8	38,3	35 H7
P1V-A360H0013••	15	200	12 H8	45,3	42 H7
P1V-A360H0006••	18	200	14 H8	48,8	45 H7

••: see previous page for installation positions

P1V-A160F0043••

P1V-A160G0043••


P1V-A160H0043••

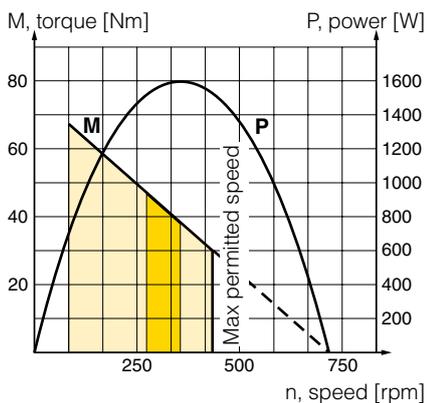

P1V-A160F0020••

P1V-A160G0020••


P1V-A160H0020••

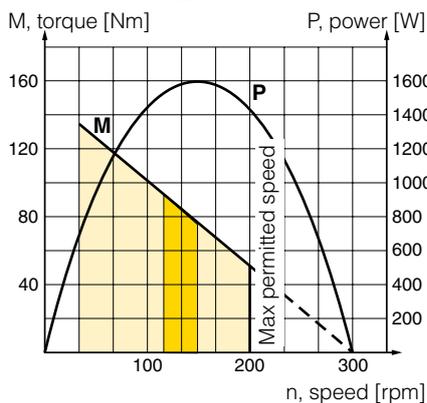

P1V-A160F0010••

P1V-A160G0010••


P1V-A160H0010••

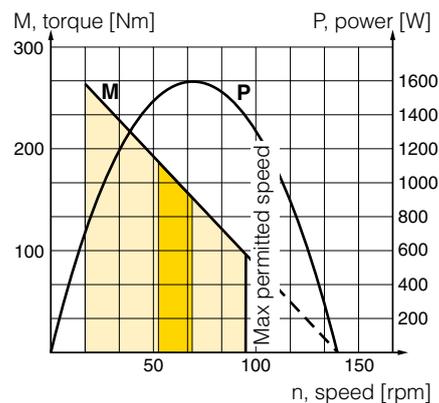

P1V-A160F0008••

P1V-A160G0008••


P1V-A160H0008••

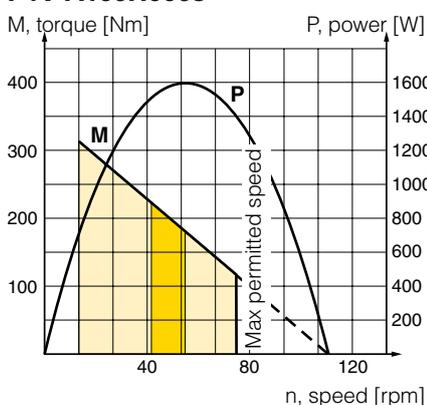

P1V-A260F0050••

P1V-A260G0050••


P1V-A260H0050••

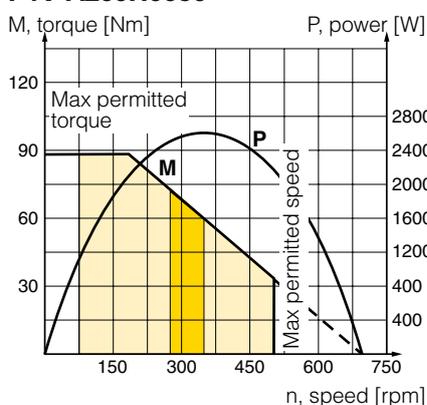

P1V-A260F0022••

P1V-A260G0022••


P1V-A260H0022••

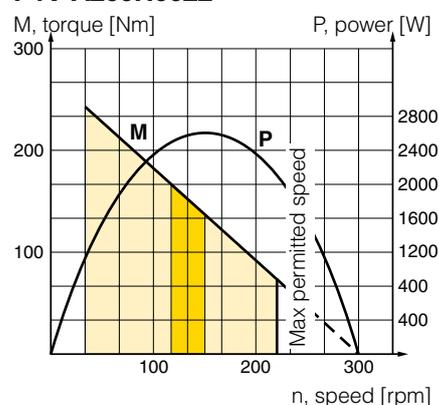

P1V-A260F0013••

P1V-A260G0013••


P1V-A260H0013••

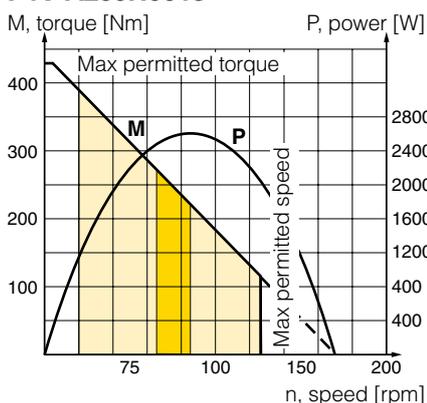


P1V-A260F0008••

P1V-A260G0008••

P1V-A260H0008••

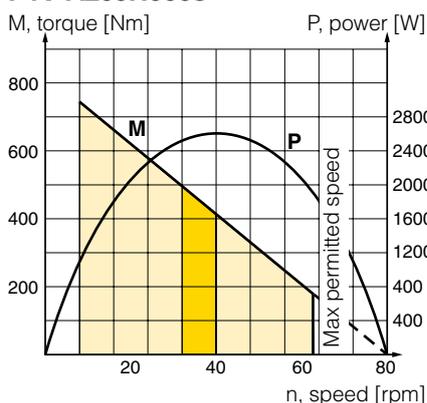


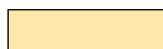 Possible working range of motor.


 Optimum working range of motor.

Higher speeds = more vane wear
Lower speeds with high torque = more gearbox wear


P1V-A360F0050••
P1V-A360G0050••
P1V-A360H0050••

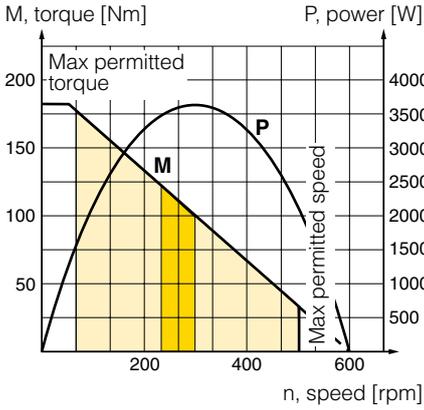


P1V-A360F0022••
P1V-A360G0022••
P1V-A360H0022••

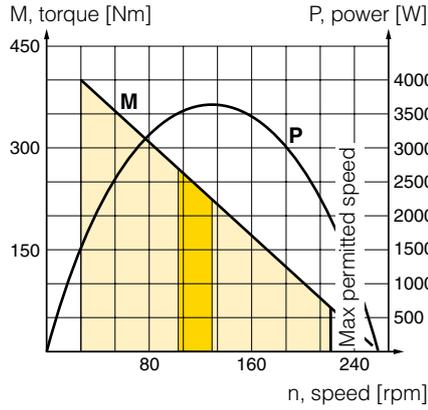

P1V-A360F0013••
P1V-A360G0013••
P1V-A360H0013••

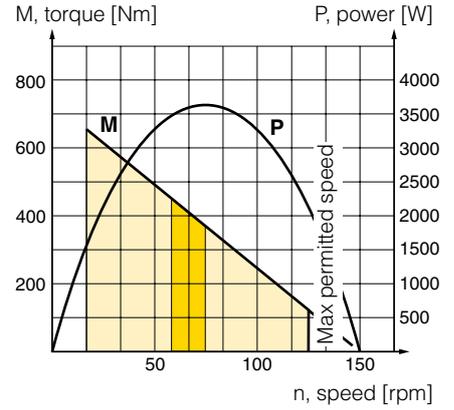

P1V-A360F0006••
P1V-A360G0006••
P1V-A360H0006••

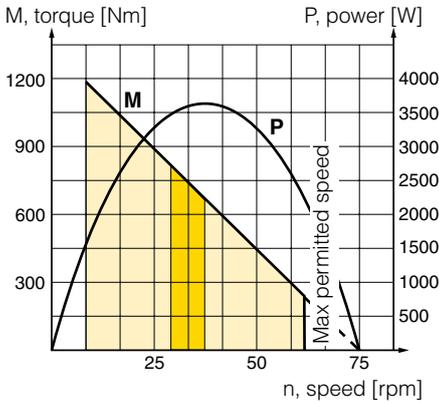

- Possible working range of motor.**
- Optimum working range of motor.**
 Higher speeds = more vane wear
 Lower speeds with high torque = more gearbox wear

Permitted shaft loadings

Radial forces

Depending on the application, the drive shaft of the gearbox can be subjected to various radial forces, which can be calculated as follows:

$$F_{rad} = 2000 \times M \times K_r / d$$

- F_{rad} Radial force (N)
- M Torque (Nm)
- d Diameter of wheel, pulley, sprocket or gear wheel (mm)
- $K_r = 1$ Sprocket constant
- $K_r = 1.25$ Gear wheel constant
- $K_r = 1.5 - 2.5$ Vee-belt pulley constant

Depending on the point of application of the force (please refer to the adjacent figure), the following two cases are found:

- a. The force is applied to the centre of the output shaft, as in figure 3. This value can be read off on the table below, where consideration must be given to the following:

$$F_{radc} \leq F_{rt}$$

- b. The force is applied at a distance x, as in figure 4. This value can be calculated as follows:

$$F_{radx} = F_{rt} \times a / (b + X) \quad L/2 < X < c$$

- F_{rt} Permissible radial force on centre of output-shaft (N)
- a Gear constant
- b Gear constant
- c Gear constant
- X Distance from shoulder on shaft to point of application of force (mm)

All values are found in the table below. The following should be considered, however:

$$F_{radc} \leq F_{radx}$$

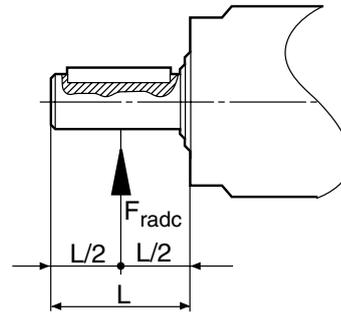


Fig. 3: Force applied at centre of shaft

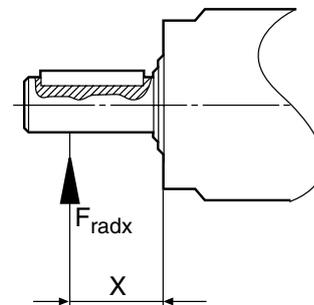


Fig. 4: Force applied at distance X


Axial forces

The maximum permissible axial force can be calculated as follows:

$$F_{ax} = F_{rt} \times 0,2$$

Motor	a	b	F_{rt} N
P1V-A160•0043••	99	69	3450
P1V-A160•0020••	132	102	4700
P1V-A160•0010••	147	117	7000
P1V-A160•0008••	147	117	7000
P1V-A260•0050••	99	69	3450
P1V-A260•0022••	147	117	7000
P1V-A260•0013••	147	117	7000
P1V-A260•0008••	182	142	13800
P1V-A360•0050••	132	102	4700
P1V-A360•0022••	147	117	7000
P1V-A360•0013••	171	134	8000
P1V-A360•0006••	182	142	13800

- Motor with worm gear (functions F, G and H)
- Installation position, optional

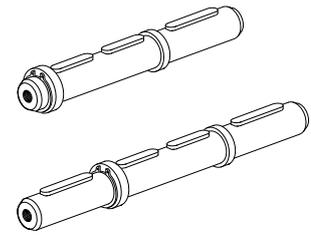


Shaft with keys for motor with worm gear

Motor type	Single-ended shaft Order code	Weight kg	Double-ended shaft Order code	Weight kg
				
Serie P1V-A160				
P1V-A160•0043••	9121510242	0,60	9121510247	0,77
P1V-A160•0020••	9121510243	0,75	9121510248	0,95
P1V-A160•0010••	9121510244	1,60	9121510249	2,00
P1V-A160•0008••	9121510244	1,60	9121510249	2,00
Serie P1V-A260				
P1V-A260•0050••	9121510242	0,60	9121510247	0,77
P1V-A260•0022••	9121510244	1,60	9121510249	2,00
P1V-A260•0013••	9121510244	1,60	9121510249	2,00
P1V-A260•0008••	9121510246	3,20	9121510251	4,10
Serie P1V-A360				
P1V-A360•0050••	9121510243	0,75	9121510248	0,95
P1V-A360•0022••	9121510244	1,60	9121510249	2,00
P1V-A360•0013••	9121510245	2,80	9121510250	3,60
P1V-A360•0006••	9121510246	3,20	9121510251	4,10

- Motor with worm gear (functions F, G and H)
- Installation position, optional

Dimensions (mm)

Shaft with keys for motor with worm gear

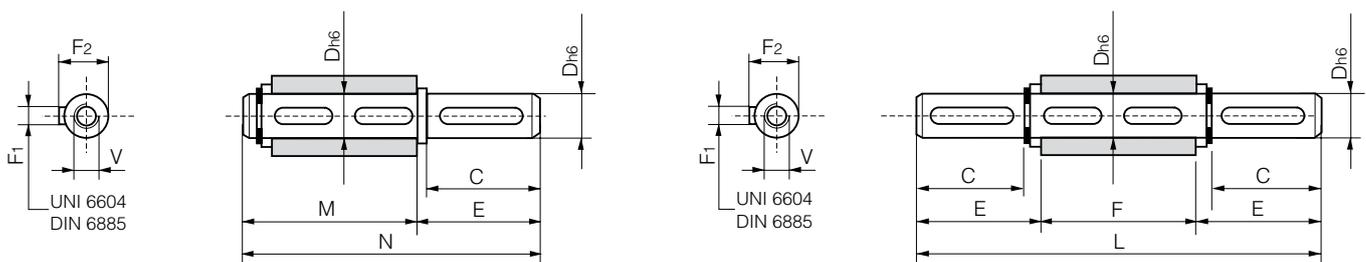

Single-ended shaft

Order code	C	D	E	F1	F2	M	N	V
9121510242	60	25	65	8	28,0	89	154	M8x20
9121510243	60	25	65	8	28,0	127	192	M8x20
9121510244	60	35	65	10	38,0	149	214	M10x25
9121510245	75	42	80	12	45,0	164	244	M12x32
9121510246	80	45	85	14	48,5	176	261	M12x32

Double-ended shaft

Order code	C	D	E	F	F1	F2	L	V
9121510247	60	25	63,20	82	8	28,0	208,4	M8x20
9121510248	60	25	63,20	120	8	28,0	246,4	M8x20
9121510249	60	35	64,00	140	10	38,0	268,0	M10x25
9121510250	75	42	79,25	155	12	45,0	313,5	M12x32
9121510251	80	45	84,75	165	14	48,5	334,5	M12x32

Material specification

Shaft: High grade steel
 Key: Hardened steel

Order key

P 1 V - A		1 6 0		E	0	0 6 6		B 6	
Motor size		Function				Free/max speed per min		Installation position	
160	1600 W	A	Basic motor without gearbox, keyed shaft			000	0000	-	Free installation
260	2600 W	B	With planetary gear, keyed shaft			900	9000	Horizontal installation	
360	3600 W	D	With helical gear, flange, keyed shaft			Optional functions		B3	Installation position B3
Air motor family		E	With helical gear, foot, keyed shaft					0	Intermittent standard vanes springs loaded
		F	With worm gear, flange left, hollow shaft with key slot			C	Continuous black vanes springs loaded	B6	Installation position B6
P1V-A	Large Air Motor	G	With worm gear, flange right, hollow shaft with key slot					B7	Installation position B7
		H	With worm gear, foot, hollow shaft with key slot					B8	Installation position B8
								Vertical installation	
								V1	Installation position V1
								V3	Installation position V3
								V5	Installation position V5
								V6	Installation position V6


Note: This model code can not be used for creating new part numbers. All possible combinations between motor size, function and free speed are in all previous pages.

Note: Oil-bath gearboxes mean that the installation position must be decided in advance. The installation position determines the volume of oil in the gearbox and location of oil filling and drain plugs.


A: Free installation positions, basic motor

B: Free installation positions, planetary gear


D: Free installation positions, helical gear and flange

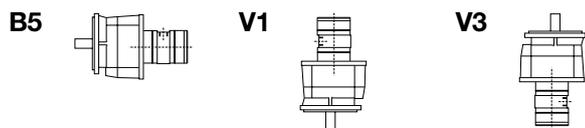


E: Installation positions, helical gear and foot

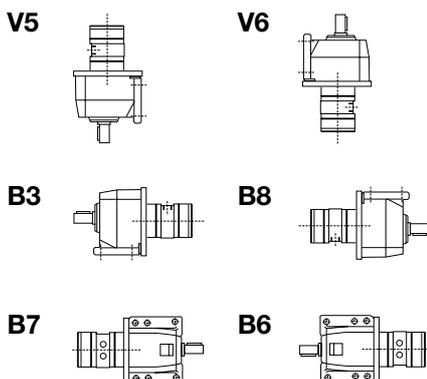


F: Installation pos., worm gear and flange, left-hand

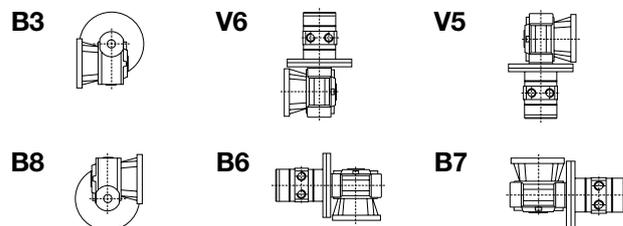

G: Installation pos., worm gear and flange, right-hand

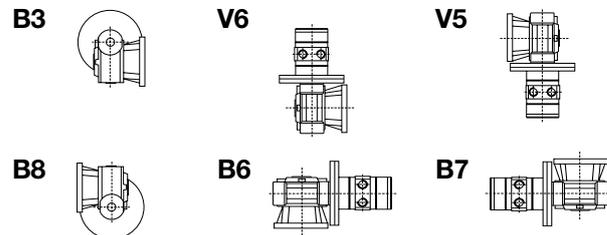

H: Installation positions, worm gear and foot

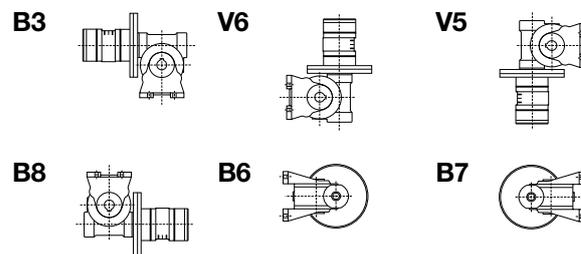

Lubrication and service life


Oil and oil mist are things which one tries to avoid to get the best possible working environment. In addition, purchasing, installation and maintenance of oil mist equipment costs money and, above all, time to achieve optimum lubrication effect.

The P1V-A motor is equipped with vanes for intermittent operation as standard for most common applications.

Service interval



The first service is due after approximately 500 hours of operation. After the first service, the service interval is determined by the degree of vane wear. The table below shows new dimensions.

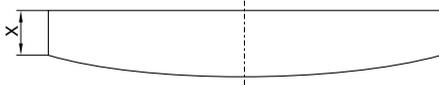

Air motor	Dimensions on new vanes X [mm]
P1V-A160	16
P1V-A260	20
P1V-A360	30

The following normal service intervals should be applied to in order to guarantee problem-free operation in air motors working continuously at load speeds.

Intermittent lubrication operation of P1V-A basic motors

Duty cycle	70%
Max. duration of intermittent use	15 minutes
Oil volume	1 drop oil/Nm ³
Filtering 40 µm	app. 750 hours operation
Filtering 5 µm	app. 1,000 hours operation

Continuous lubrication operation of P1V-A basic motors


Oil volume	1 drop oil/Nm ³
Filtering 40 µm	app. 1,000 hours operation
Filtering 5 µm	app. 2,000 hours operation

Continuous lubrication operation of P1V-A basic motors

Filtering 40 µm	app. 750 hours operation
Filtering 5 µm	app. 1,000 hours operation

Service kits

The following kits are available for the basic motors, consisting of vanes, O-rings and springs:

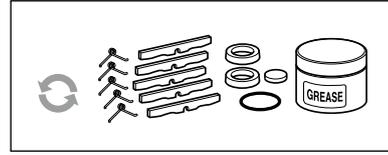

Service kit, vanes for intermittent lubrication operation, option "0"

For motor	Order code
P1V-A160A0900	9121720630
P1V-A260A0700	9121720631
P1V-A360A0600	9121720632

Service kit, vanes for continuous lubrication operation, option "C"

For motor	Order code
P1V-A160AC900	9121720633
P1V-A260AC700	9121720634
P1V-A360AC600	9121720635

For more information about our maintenance services, please contact your local parker sales office.



Very Large Air Motors

P1V-B: 5.1, 9 & 18 kW

Contents	Page
Very Large Air Motors.....	49
Material and technical specification.....	49
Very Large Air Motors, 5100, 9000 & 18000 watts.....	49
Dimensions.....	50

P1V-B Very Large Air Motors

Note: All technical data are based on a working pressure of 6 bar and with oil. Speed tolerance accuracy is +10%.



Very Large Air Motors

These large motors are designed for use in the most arduous applications, requiring considerable power, torque, robustness and reliability.

Reversible motor without gear box, IEC Flange

Max power	Free speed	Speed at max power	Torque at max power	Min start torque	Air consumption at max power	Conn.	Min pipe ID	Weight	Order code
kW	rpm	rpm	Nm	Nm	m ³ /min		mm	Kg	
5,1	6000	3000	16.2	24.4	6.2	G1	25	27	P1V-B510A0600
9	6000	3000	28.6	43	10	G1	25	25	P1V-B900A0600
18	6000	3000	57	85	20	G2	43	54	P1V-BJ00A0600

Technical data

Air motor size & type	P1V-B510	P1V-B900	P1V-BJ00
Nominal power (watts)	5100	9000	18000
Working pressure (bar)	3 to 7		
Working temperature (°C)	-30 to +100		
Ambient temperature (°C)	-30 to +100		
Air flow required (l/min)	6200	10000	20000
Min pipe ID, inlet (mm)	25	25	43
Min pipe ID, outlet (mm)	25	25	43
Choice of treatment unit: recommended min air flow (l/min) at p1 7.5 bar and 0.8 bar pressure drop			
	6400	10300	20400
Choice of valve: recommended min nominal air flow (l/min) at p1 6 bar and 1 bar pressure drop			
	6600	10600	20800
Medium	40µm filtered, oil mist or dry unlubricated compressed air		
Oil operation	1-2 drop per cube meter, ISO8573-1 purity class 3.-.5		
Recommended oil	Foodstuffs industry Klüberoil 4 UH 1-32		
Shaft radial force (N)	7500	7500	7500
Shaft axial force (N)	11000	11000	11000
Sound level free outlet (dB(A))	X	X	X
With outlet silencer (dB(A))	X	X	X

Note: sound levels are measured at free speed with the measuring instrument positioned 1 meter away from the air motor at an height of 1 meter.


Material specification

Air motor size & type	P1V-B510	P1V-B900	P1V-BJ00
Motor housing	Cast iron, synthetic paint, black color		
Shaft	High grade steel		
Key	Hardened steel		
External seal	Nitrile rubber, NBR		
Internal steel parts	High grade steel		
Motor lubrication	Foodstuffs industry Klüber oil 4 UH 1-32		
Vanes	Patented, no data		


P1V-B Very Large Air Motors

Dimensions (mm)


Flange motor 68-0054/IEC112A (P1V-B510)

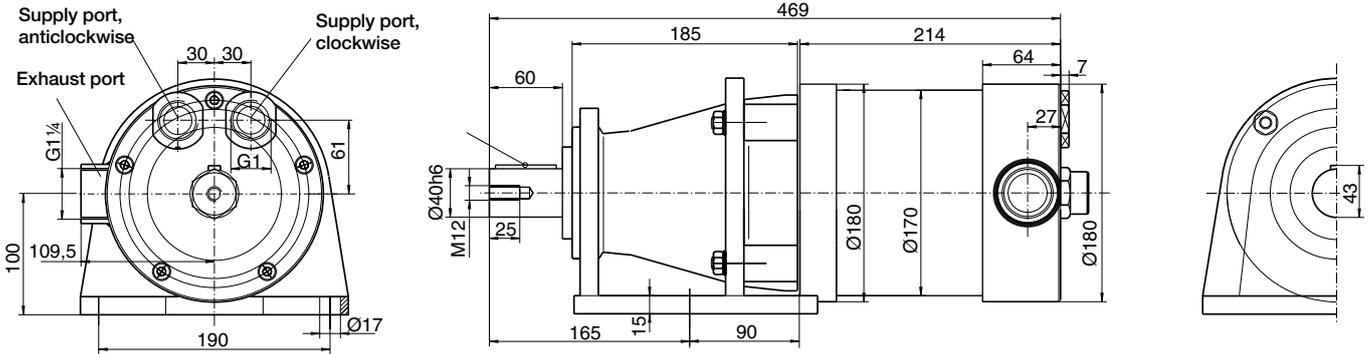

Flange motor 68-0055/IEC112A (P1V-B900)

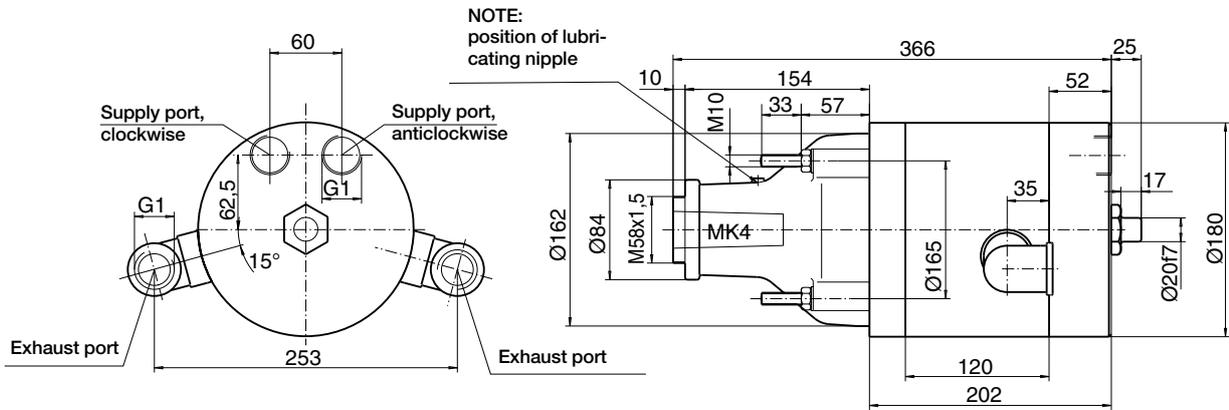

Flange motor 68-0065/IEC112A (P1V-BJ00)

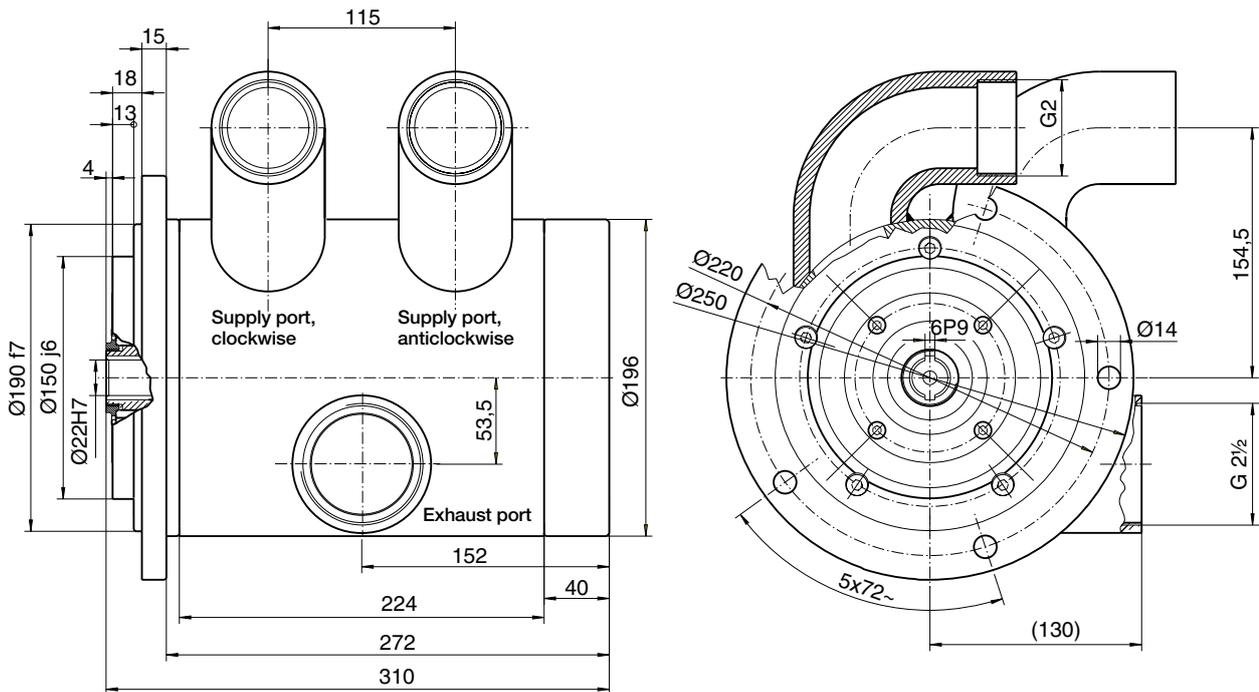

Parker Worldwide

Europe, Middle East, Africa

AE – United Arab Emirates, Dubai

Tel: +971 4 8127100
parker.me@parker.com

AT – Austria, Wiener Neustadt

Tel: +43 (0)2622 23501-0
parker.austria@parker.com

AT – Eastern Europe, Wiener Neustadt

Tel: +43 (0)2622 23501 900
parker.easteurope@parker.com

AZ – Azerbaijan, Baku

Tel: +994 50 2233 458
parker.azerbaijan@parker.com

BE/LU – Belgium, Nivelles

Tel: +32 (0)67 280 900
parker.belgium@parker.com

BY – Belarus, Minsk

Tel: +375 17 209 9399
parker.belarus@parker.com

CH – Switzerland, Etoy

Tel: +41 (0)21 821 87 00
parker.switzerland@parker.com

CZ – Czech Republic, Klecany

Tel: +420 284 083 111
parker.czechrepublic@parker.com

DE – Germany, Kaarst

Tel: +49 (0)2131 4016 0
parker.germany@parker.com

DK – Denmark, Ballerup

Tel: +45 43 56 04 00
parker.denmark@parker.com

ES – Spain, Madrid

Tel: +34 902 330 001
parker.spain@parker.com

FI – Finland, Vantaa

Tel: +358 (0)20 753 2500
parker.finland@parker.com

FR – France, Contamine s/Arve

Tel: +33 (0)4 50 25 80 25
parker.france@parker.com

GR – Greece, Athens

Tel: +30 210 933 6450
parker.greece@parker.com

HU – Hungary, Budapest

Tel: +36 1 220 4155
parker.hungary@parker.com

IE – Ireland, Dublin

Tel: +353 (0)1 466 6370
parker.ireland@parker.com

IT – Italy, Corsico (MI)

Tel: +39 02 45 19 21
parker.italy@parker.com

KZ – Kazakhstan, Almaty

Tel: +7 7272 505 800
parker.easteurope@parker.com

NL – The Netherlands, Oldenzaal

Tel: +31 (0)541 585 000
parker.nl@parker.com

NO – Norway, Asker

Tel: +47 66 75 34 00
parker.norway@parker.com

PL – Poland, Warsaw

Tel: +48 (0)22 573 24 00
parker.poland@parker.com

PT – Portugal, Leca da Palmeira

Tel: +351 22 999 7360
parker.portugal@parker.com

RO – Romania, Bucharest

Tel: +40 21 252 1382
parker.romania@parker.com

RU – Russia, Moscow

Tel: +7 495 645-2156
parker.russia@parker.com

SE – Sweden, Spånga

Tel: +46 (0)8 59 79 50 00
parker.sweden@parker.com

SK – Slovakia, Banská Bystrica

Tel: +421 484 162 252
parker.slovakia@parker.com

SL – Slovenia, Novo Mesto

Tel: +386 7 337 6650
parker.slovenia@parker.com

TR – Turkey, Istanbul

Tel: +90 216 4997081
parker.turkey@parker.com

UA – Ukraine, Kiev

Tel: +380 44 494 2731
parker.ukraine@parker.com

UK – United Kingdom, Warwick

Tel: +44 (0)1926 317 878
parker.uk@parker.com

ZA – South Africa, Kempton Park

Tel: +27 (0)11 961 0700
parker.southafrica@parker.com

North America

CA – Canada, Milton, Ontario

Tel: +1 905 693 3000

US – USA, Cleveland

Tel: +1 216 896 3000

Asia Pacific

AU – Australia, Castle Hill

Tel: +61 (0)2-9634 7777

CN – China, Shanghai

Tel: +86 21 2899 5000

HK – Hong Kong

Tel: +852 2428 8008

IN – India, Mumbai

Tel: +91 22 6513 7081-85

JP – Japan, Tokyo

Tel: +81 (0)3 6408 3901

KR – South Korea, Seoul

Tel: +82 2 559 0400

MY – Malaysia, Shah Alam

Tel: +60 3 7849 0800

NZ – New Zealand, Mt Wellington

Tel: +64 9 574 1744

SG – Singapore

Tel: +65 6887 6300

TH – Thailand, Bangkok

Tel: +662 186 7000-99

TW – Taiwan, Taipei

Tel: +886 2 2298 8987

South America

AR – Argentina, Buenos Aires

Tel: +54 3327 44 4129

BR – Brazil, Sao Jose dos Campos

Tel: +55 800 727 5374

CL – Chile, Santiago

Tel: +56 2 623 1216

MX – Mexico, Apodaca

Tel: +52 81 8156 6000

European Product Information Centre

Free phone: 00 800 27 27 5374

(from AT, BE, CH, CZ, DE, DK, EE, ES, FI, FR, IE, IL, IS, IT, LU, MT, NL, NO, PL, PT, RU, SE, SK, UK, ZA)

Parker Hannifin Ltd.

Tachbrook Park Drive
Tachbrook Park,
Warwick, CV34 6TU
United Kingdom
Tel.: +44 (0) 1926 317 878
Fax: +44 (0) 1926 317 855
parker.uk@parker.com
www.parker.com

